

## I HONDA Tech Line Summary Article

February 2017 ATS 170208 Version 1

## Auto High-Beam System Indicator, Fog Lights, and Automatic **Intermittent Wipers Not Working**

## AFFECTED VEHICLES

2017 CR-V (EX and above)

When installing the shipping fuses, never do it with the engine running. If you do, you could wind up with any of these issues:

- With the headlight switch in AUTO, the Auto High-Beam System indicator won't come on.
- With the headlight switch in AUTO, the fog lights won't come on with the low beam headlights on.
- The automatic intermittent wipers won't work.

If this is the case, following these steps should restore things to normal:

- Turn the ignition to OFF.
- Remove the No. 18 BACKUP (10 A) fuse from the under-hood fuse/relay box.
- Wait a few minutes, then install the fuse.

© 2017 American Honda Motor Co., Inc. - All Rights Reserved