**HONDA** Tech Line Summary Article

## June 2017

ATS 170208 Version 2

## Auto High-Beam System Indicator, Fog Lights, and Automatic Intermittent Wipers Not Working

## **AFFECTED VEHICLES**

2017 CR-V (EX and above)

EDITOR'S NOTE: This article replaces the one posted in February 2017 to extend the article's shelf life. The issue(s) covered are still being addressed.

When installing the shipping fuses, **never** do it with the engine running. If you do, you could wind up with any of these issues:

- With the headlight switch in AUTO, the Auto High-Beam System indicator won't come on.
- With the headlight switch in AUTO, the fog lights won't come on with the low beam headlights on.
- The automatic intermittent wipers won't work.

If this is the case, following these steps should restore things to normal:

- 1. Turn the ignition to OFF.
- 2. Remove the No. 18 BACKUP (10 A) fuse from the under-hood fuse/relay box.
- 3. Wait a few minutes, then install the fuse.

© 2017 American Honda Motor Co., Inc. – All Rights Reserved