

SSM  
46549

Some 2017 Focus vehicles equipped with 1.0L Gasoline Turbo Direct Injection (GTDI) engines built on 27-Feb-2017 and through 12-Apr-2017 may exhibit excessive engine idle vibrations. Inspect the engine torque restrictor installed part numbers. Automatic transmission equipped vehicles, should have BV61-6P082-CB installed. Manual transmission vehicles should have CV61-6P082-DC installed. Refer to Workshop Manual (WSM), Section 303-08 for remove instructions. For claiming, use causal part 6068 and applicable labor operations in section 06-Engine of the service labor time standards (SLTS) manual.