



PRODUCT NOTICE

PN630

DATE: 2/1/17

REVISED:

TO: Owners, Users, Dealers, and Installers

Models Affected: TLM

SUBJECT: Load Chart

Issue:

Terex has determined that some aerial devices manufactured from January 2015 through August 2016 may contain an incorrect load chart. **Loading the jib to the maximum capacity could result in a delay in the platform leveling system.**

Action:

What the Owner must Do:

- 1) Immediately inspect the load chart according to the inspection procedure below to determine if your unit is subject to this bulletin.
- 2) Replace the load chart with the load chart supplied in the envelope and fill out the completion form if your unit is subject to this bulletin.

Inspection Procedure:

Using Figure A, locate the load chart at the platform.

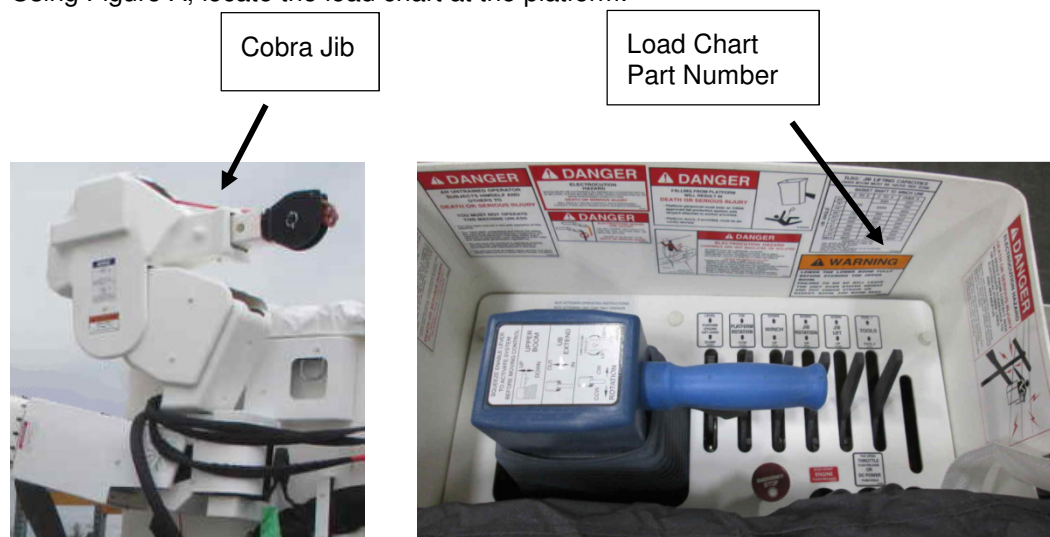


Figure A. Load Chart Location

Only TLM end mount platform units with a Cobra Jib and a load chart with the following part numbers are subject to this bulletin

Load chart part numbers: 492508, 493014, 494373, 495460, 499778, 604941, 605421, or 605530

Any TLM unit with a Cobra Jib that does not have a load chart with a part number above is not subject to this bulletin.

**Continued Use:**

Always follow all maintenance and inspection requirements as specified in the manuals. Owners may continue to use the unit provided all machine users and operators are notified of these continued use requirements.

- 1) Locate the load chart for the specific serial number referenced in the owner letter.
- 2) Do not exceed the maximum jib load shown on the replacement chart.

If you have any questions you can find your nearest dealer at this web site;

<http://www.terex.com/utilities/en/products/dealer-locator/index.htm>.

What Terex will Do:

Terex will supply a new load chart for any unit involved in this bulletin at no cost to the owner.

Dealers and Installers: A letter is being sent to owners of affected units. If an owner contacts you about this bulletin, contact TEREX Utilities, at 605-882-4000, for further instructions.

Important: Some of the involved units may be in rental fleets. Terex requires the owner to complete the bulletin service on these units before renting, and to inform the renters of affected units within 10 days of receipt of this bulletin.