



Service Bulletin

PRELIMINARY INFORMATION

Subject: DTC P228D

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade CTS V	2017	2017	SOP	END	6.2L, L86, LT4,	Any
Chevrolet	Camaro, Corvette, Silverado, Suburban, Tahoe	2017	2017	SOP	END	4.3L, 5.3L, 6.2L, L83, L8B, L86, LT1, LT4, LV3	Any
GMC	Sierra, Yukon Models	2017	2017	SOP	END	4.3L 5.3L, 6.2L, L83, L8B, L86, LV3	Any

Involved Region or Country	North America
Additional RPO/s:	L83 L86 L8B LT1 LT4 LV3
Condition	A vehicle may come in with DTC P228D (Fuel Pressure Regulator Control Performance - High Pressure) set current or history.
Cause	A fault with the fuel rail pressure sensor. Do not replace the Engine's High Pressure Pump.

Correction

If this is encountered it is recommended to replace the Fuel Rail Pressure sensor.

Parts Information

Description	Part Number	Qty
Fuel Rail Pressure Sensor	12664124	1

Warranty Information

Labor Operation	Description	Labor Time
4022490*	Fuel Injection Fuel Rail Fuel Pressure Sensor Replacement	Use published labor time
	*This is a unique Labor Operation for Bulletin use only.	

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION