



Service Bulletin

PRELIMINARY INFORMATION



Subject: Check engine light- P0446- Check EVAP canister for restriction

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2013	2017	SOP	END	ALL	ALL
Chevrolet	Sonic	2012	2017	SOP	END	ALL	ALL
Chevrolet	Trax	2013	2017	SOP	END	ALL	ALL

Involved Region or Country	North America
Additional RPO/s:	N/A
Condition	Check Engine Light ; P0446
Cause	Restriction in fresh air inlet port caused by spiders

Correction

Remove the evap canister vent cap and Inspect evap canister for spider nesting in the fresh air inlet port (see picts). Replace evap canister.

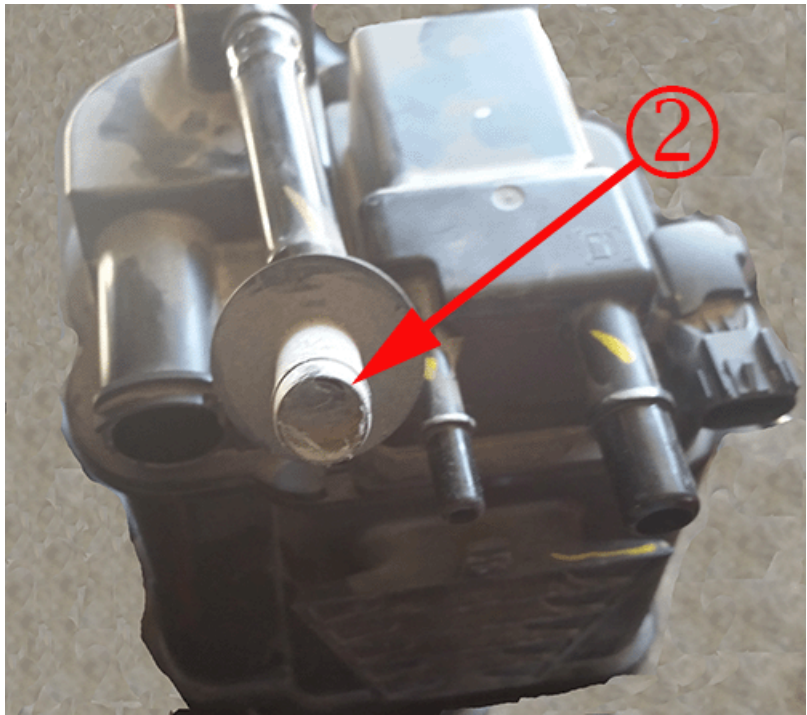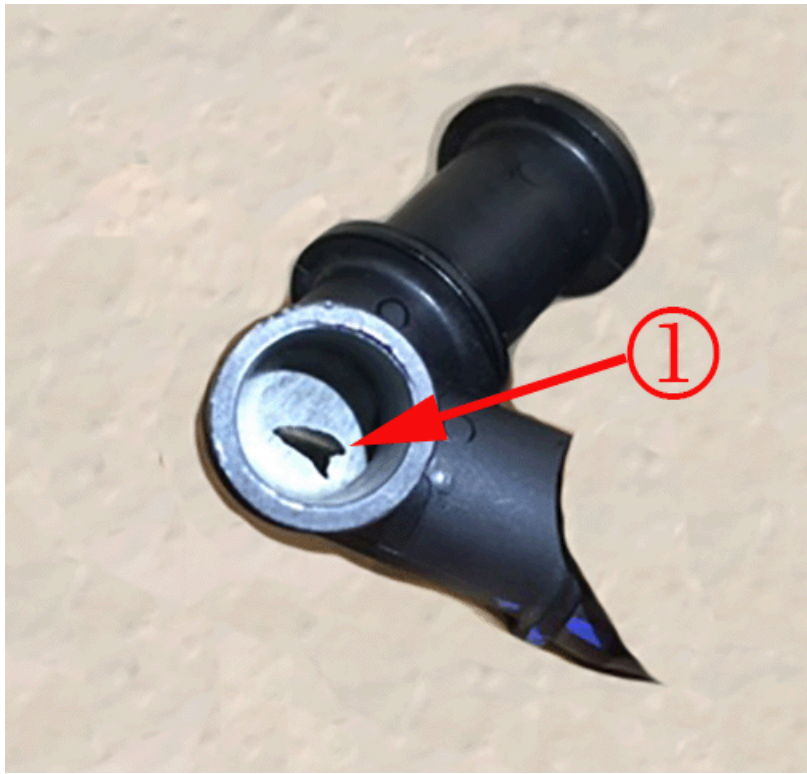



Parts Information

Description	Part Number	Qty
Sonic / Canister Kit	95174448	1
Encore, Trax / Canister	95128163	1

Warranty Information

Labor Operation	Description	Labor Time
4027950	Evaporative Emission Canister Replacement	Use Published Labor Operation Time
	*This is a unique Labor Operation for Bulletin use only.	

Version	2
Modified	01-26-2017 Update Part information

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION