





# Preliminary Information

PIP5476 No crank, loss of communication with ECM and TCM, ignition key stuck in ignition cylinder, dead battery

## Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2017	ALL	ALL	3.6 LGZ	ALL
GMC	Canyon	2017	ALL	ALL	3.6 LGZ	ALL
Involved Region or Country	North America					
Additional Options (RPO)	N/A					
Condition	Some customers may comment on one of the following conditions: Intermittent, No crank, loss of communication with ECM and TCM, ignition key stuck in ignition cylinder, dead battery DTC's P018C P0449 P0452 P0463 U0101 U0100 U0401 U0121 U0131 U18A2 P0522 P16E5 P0118 may also be set.					
Cause	This condition may be caused by a loose ECM TCM ground on driver's side cylinder head (see illustration).					

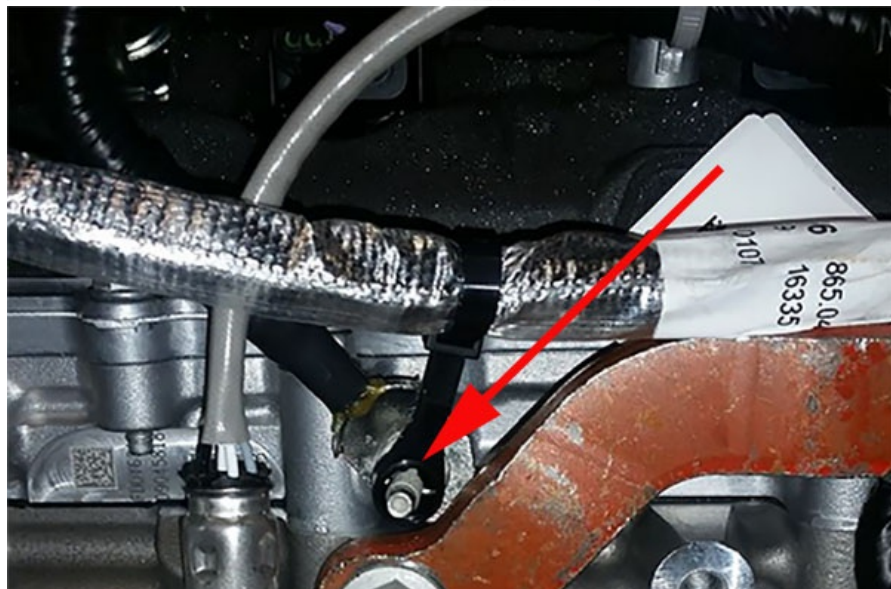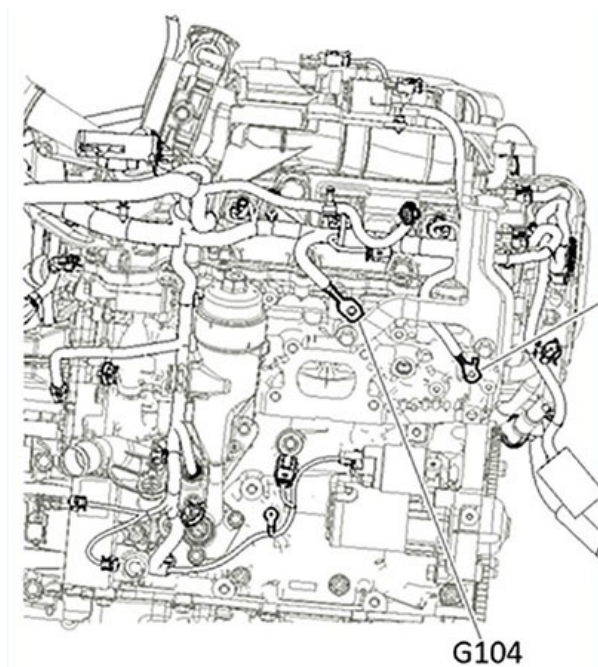

Correction:

Inspect G104 and tighten or repair as necessary.

### Version History

Version	1
Modified	



©2016 General Motors. All Rights Reserved.