



# Preliminary Information


PIC6250B Check engine light- P0446- Check EVAP canister for restriction

## Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Encore	2013 - 2017	All	All	All	All
Chevrolet	Sonic	2012 - 2017	All	All	All	All
Chevrolet	Trax	2013 - 2017	All	All	All	All
Involved Region or Country	North America					
Condition	Check Engine Light ; P0446 or P0455					
Cause	Restriction in fresh air inlet port caused by spiders					

## Correction:

Remove the evap canister vent cap and inspect evap canister for spider nesting in the fresh air inlet port (see pictures). Replace evap canister.

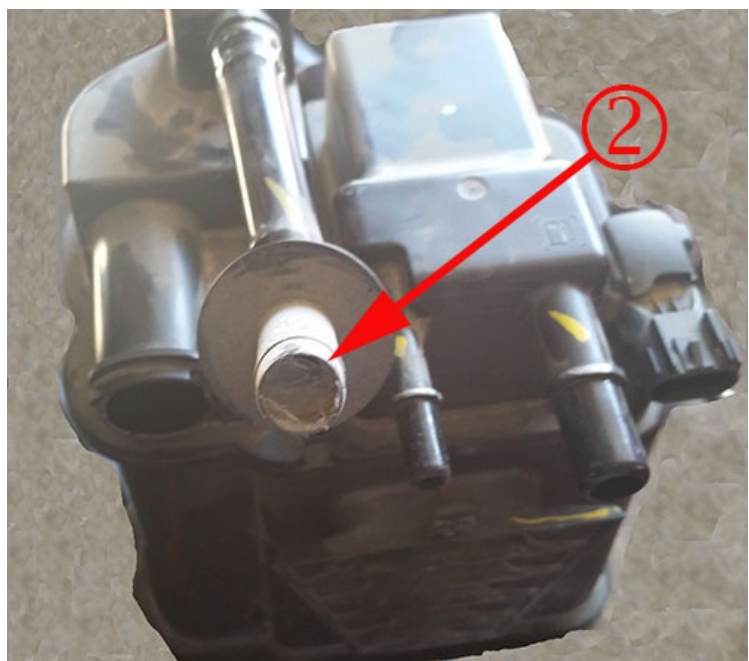



**Parts Information**

Description	Part Number	QTY
Sonic / Canister Kit	95174448	1
Encore, Trax / Canister	95128163	1

**Warranty Information**

Labor Operation	Description	Labor Time
4027950	Evaporative Emission Canister Replacement	Use Published Labor Operation Time
*This is a unique Labor Operation for Bulletin use only.		

**Version History**

Version	3
Modified	01-26-2017 Update Part information
	02-28-2017 Update Condition Field



©2016 General Motors. All Rights Reserved.