



# Preliminary Information

## PIP5455A LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CTS-V	2016 - 2017	All	All	6.2L LT4	All
Chevrolet	Camaro	2017	All	All	6.2L LT4	All
Chevrolet	Corvette	2015 - 2017	All	All	6.2L LT4	All
Involved Region or Country	North America					
Additional Options (RPO)	LT4					
Condition	There may be a concern with a rattle or flutter noise from the supercharger tensioner and belt. This occurs in V4 mode with light throttle conditions. Issue sounds like tick noise when in driver seat. This seems to vary between vehicles but replacing the tensioner won't resolve the issue.					
Cause	The supercharger belt tensioner will jump and cause the noise.					

### Correction:

Replace the supercharger belt with a Gates Belt P/N K080852HD.

### Parts Information

Part Number (Gates)	Description	Quantity
K080852HD	Supercharger Belt	1

### Warranty Information

Labor Operation	Description	Labor Time
4062850	Supercharger Belt Replacement	Use Published labor time
*This is a unique Labor Operation for Bulletin use only.		

### Version History

Version	2
Modified	4/18/2015- Updated to to add a supercharger belt part number

