



# Preliminary Information

## PIT5506A 45-65 MPH Vibration or Growl Noise

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2500	2011 - 2017	All	All	All	All
GMC	Sierra 2500	2011 - 2017	All	All	All	All

Only With Firestone Transforce LT245/75R17 Load Range E Tires (RPO QHQ)

### Supersession Statement

This PI was superseded to add 2017 Models. Please discard PIT5506.

### Condition / Concern

Some customers may have Vibration or Growl Noise between 45-65 MPH.

### Recommendations / Instructions

This vibration or growl noise can be difficult to diagnose and using the Pico Scope is recommended. The Pico Scope may show a 1st order propshaft or 4th order tire vibration during the test drive, if this is found swap different size tires (preferably LT265/70R18 or LT265/70R17 both load range E) to verify the condition is eliminated. If the concern is corrected, contact GM Technical Assistance for further direction.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

