



Service Bulletin

INFORMATION

Subject: Diagnostic Tip for Supplemental Inflatable Restraints (SIR) Indicator Lamp Illuminated - DTCs B0012, B0013 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	LaCrosse	2016	2017				
Chevrolet	Malibu						

Involved Region or Country	North America, Israel
Condition	<p>Some customers may comment that the SIR lamp is on.</p> <p>The Technician may find one or more of the following DTCs set:</p> <ul style="list-style-type: none">• B0012• B0013
Cause	This condition may be caused by the air bag electrical connector not being fully seated.
Correction	<p>Important: The driver side steering wheel air bag will still deploy if an event occurs.</p> <p>If you encounter a vehicle with either DTC set, inspection of the drivers side steering wheel airbag electrical connectors must be completed.</p>

Parts Information

No parts are required for this repair.

Warranty Information

Labor Operation	Description	Labor Time
5430922	Connector Reconnection	Use Published Labor Operation Time

Service Procedure

Warning: Refer to SIR WARNING.

Important: Follow SIR Disable and Enable procedures.

Using Care, remove the steering wheel air bag and verify that the steering wheel air bag electrical connectors are fully seated. Refer to *Steering Wheel Airbag Replacement* in SI.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION