



# Preliminary Information

PIT5577 SIR MIL On, Service AWD or Service Keyless Start Message or Fuse Open In Rear BEC.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018	All	All	All	All
Involved Region or Country:		North America				
Additional RPO/s:		None				
Condition:		SIR MIL on, Service AWD or Keyless Start message , fuse open in the Rear BEC.				
Cause:		Wiring harness pinched between body and seat bracket behind the rear seat.				

Correction:

Fold rear seatbacks down. Remove the rear cargo area trim to access harness. Inspect for damage and repair as necessary.



Follow instructions for the wiring repairs in eSI.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	