
TSB #	TSB 17-002		
Description/Title:	Axis/Vegas Hood Bracket Modification for Wiper System Clearance		
Affected Product Line(s):	Certain 2018 Axis/Vegas Motorhomes		
Service Campaign # :	RC000139	Released Date:	7/12/2017
Failure Code:	TMCTS80293W	Document Date:	7/12/2017
Time Allowed:	0.5 hr	Document Revision:	A

On certain 2018 Axis/ Vegas units the wiper linkage may brush against the driver's side hood hinge bracket causing noise.

Repair Instructions:

NOTE: Take care when completing this repair. Thor Motor Coach will not cover damage incurred to the unit that occurs during the process of completing this repair.

- 1. Open the hood.**
- 2. Access the driver's side hood hinge bracket. It will be just beneath the lower right hand corner of the hood opening. See figure 1/**

Figure 1




The repairs for Axis and Vegas vehicles are slightly different. Make sure you are looking at the diagram for the applicable make of vehicle before proceeding with the repair.

- 3. Grind the corner off of the bracket as illustrated in the appropriate diagram on page 2.**
- 4. Clean the area of any debris created by the grinding process.**
- 5. Paint the newly exposed metal black.**

AXIS

2018 Axis Hinge, Front Access

Remove the corner in "red". Measure approx. 1.00" down and cut up to top of bracket at the bend.

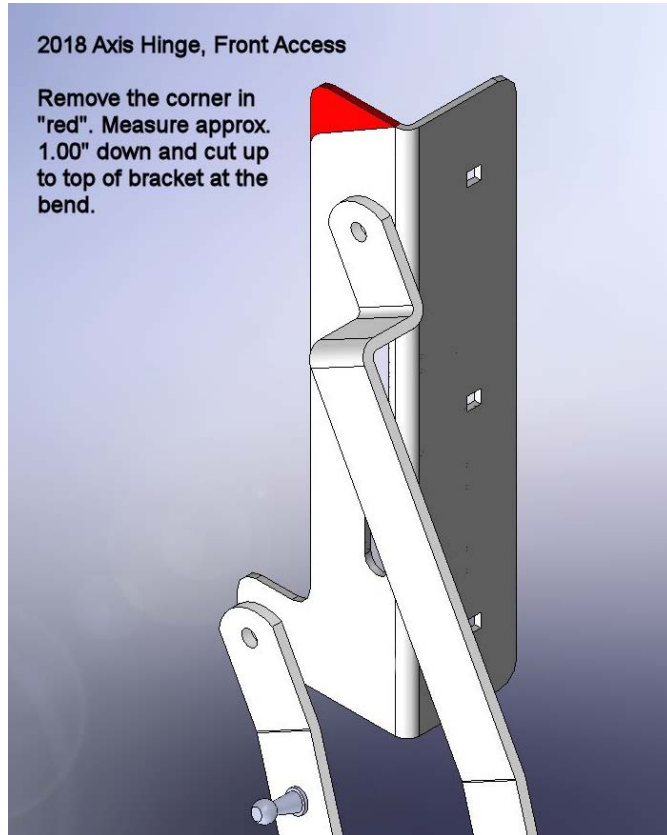

VEGAS

2018 Vegas Hinge, Front Access

Remove the corner of the arm in "red". Measure approx. .81" down and 2.25" in and cut off.

