



Michael A. Berardi
 Director
 Service Engineering Operations
 Ford Customer Service Division

Ford Motor Company
 P. O. Box 1904
 Dearborn, Michigan 48121

July 12, 2017

TO: All U.S. Ford and Lincoln Dealers

SUBJECT: **Customer Satisfaction Program 16B15 – Supplement #1**
 Certain 2007-2008 Model Year Ranger Vehicles
 Driver Airbag Inflator Replacement

New! REASON FOR THIS SUPPLEMENT

- *Part return records indicate that many of the original inflators replaced under this program have not been returned to Takata Corporation for this important investigation.*
- *Dealers are asked to immediately inspect their warranty part return storage areas for these inflators (7L5Z-10044A74-A), and return to Takata Corporation.*
- *Refer to Attachment IV – Inflator Return Shipping Instructions, which are unique to this program.*

AFFECTED VEHICLES

Vehicle	Model Year	Assembly Plant	Build Dates
Ranger	2007-2008	Twin Cities	January 9, 2006 through August 18, 2008

Affected vehicles are identified in OASIS and FSA VIN Lists.

REASON FOR THIS PROGRAM

This program is a proactive effort to gather parts for a joint investigation by Ford and the National Highway Traffic Safety Administration (NHTSA). Ford is voluntarily conducting this program to replace certain airbag inflators manufactured by Takata Corporation on vehicles always registered and always residing in Arizona, Florida, or Michigan. The replacement inflators being installed contain no enhancements and are identical to the inflators being removed. The purpose of this program is to obtain field parts for testing being administered by Takata.

A defect determination has not been made.

SERVICE ACTION

Dealers are to replace the driver airbag inflator. This service must be performed on all affected vehicles at no charge to the vehicle owner.

NOTE: All original replaced airbag inflators must be returned to Takata Corporation. **Do NOT attempt to return parts replaced under this program through the Regional Core Recovery Center.** Refer to Attachment IV – Inflator Return Shipping Instructions.

OWNER NOTIFICATION MAILING SCHEDULE

Owner letters are expected to be mailed the week of September 12, 2016. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Attachment IV: Inflator Return Shipping Instructions
Owner Notification Letter

QUESTIONS & ASSISTANCE

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician Society (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Sincerely,



Michael A. Berardi

Customer Satisfaction Program 16B15 – *Supplement #1*
Certain 2007-2008 Model Year Ranger Vehicles
Driver Airbag Inflator Replacement

OASIS ACTIVATION

OASIS will be activated on September 7, 2016.

FSA VIN LISTS ACTIVATION

FSA VIN Lists will be available through <https://web.fsavinlists.dealerconnection.com> on September 7, 2016. Owner names and addresses will be available by September 23, 2016.

NOTE: Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this program is a violation of law in several states, provinces, and countries. Accordingly, you must limit the use of this listing to the follow-up necessary to complete this service action.

STOCK VEHICLES

- Use OASIS to identify any affected vehicles in your used vehicle inventory.

SOLD VEHICLES

- Owners of affected vehicles will be directed to dealers for driver airbag inflator replacement.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Service other affected vehicles identified in OASIS which are brought to your dealership.

TITLE BRANDED / SALVAGED VEHICLES

Affected title branded and salvaged vehicles are eligible for this service action.

ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site prior to completing the repair.

RENTAL VEHICLES

The use of rental vehicles is not approved for this program.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using Direct Warranty Entry (DWE) or One Warranty Solution (OWS).
 - DWE: refer to ACESII manual for claims preparation and submission information.
 - OWS: when entering claims in DMS software, select claim type 31: Field Service Action. The FSA number (16B15) is the sub code.
- Additional labor and/or parts must be claimed as related damage on a separate repair line from the FSA.
- PROGRAM TERMS: This program will expire when a sufficient number of field parts have been returned for testing. There is no mileage limit for this program. An updated dealer bulletin will be posted and OASIS and FSA VIN lists will be turned off when this program expires.

Customer Satisfaction Program 16B15 – *Supplement #1*
 Certain 2007-2008 Model Year Ranger Vehicles
 Driver Airbag Inflator Replacement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Replace Driver Airbag Inflator	16B15B	0.4 Hours

PARTS REQUIREMENTS / ORDERING INFORMATION

Part Number	Description	Order Quantity
7L5Z-10044A74-A	Driver Airbag Inflator Kit	1

NOTE: All original replaced airbag inflators must be returned to Takata Corporation.

The DOR/COR number for this program is 51052.

Order your parts requirements through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

DEALER PRICE

For latest prices, refer to DOES II.

PARTS RETENTION AND RETURN

All original replaced airbag inflators must be returned to Takata Corporation. **Do NOT return parts replaced under this program through the Regional Core Recovery Center.** Each airbag inflator kit includes a return shipping label. Refer to Attachment IV – Inflator Return Shipping Instructions.

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

CERTAIN 2007-2008 RANGER VEHICLES — DRIVER AIRBAG INFLATOR REPLACEMENT

OVERVIEW

This program is a proactive effort to gather parts for a joint investigation by Ford and the National Highway Traffic Safety Administration (NHTSA). Ford is voluntarily conducting this program to replace certain airbag inflators manufactured by Takata Corporation on vehicles always registered and always residing in Arizona, Florida, or Michigan. The replacement inflators being installed contain no enhancements and are identical to the inflators being removed. The purpose of this program is to obtain field parts for testing being administered by Takata. A defect determination has not been made. Dealers will remove the airbag from the vehicle and replace only the inflator portion of the airbag. The original (old) inflator will be placed into the packaging from the *new* inflator and shipped to Takata Corporation using the included return shipping label.

SERVICE PROCEDURE

 **WARNING:** Failure to follow the instructions and warnings in the Workshop Manual (WSM) may result in injury.

NOTE: If the Airbag Readiness light indicates no Supplemental Restraint System (SRS) faults are present, it is not necessary to follow the WSM SRS Depowering and Repowering steps. Turn the ignition to OFF and wait 1 minute, then it is safe to proceed with airbag inflator replacement.

NOTE: The ignition must remain OFF until this service procedure is completed.

1. Remove the driver airbag from the vehicle. Please follow the WSM procedures in Section 501-20B.
2. Set the airbag face down onto a surface that will not scratch or damage the airbag face.

 **WARNING:** Do not allow any debris on or around airbag once the inflator is removed.



3. Remove and discard the four airbag inflator retaining nuts from the driver side airbag. See Figure 1.

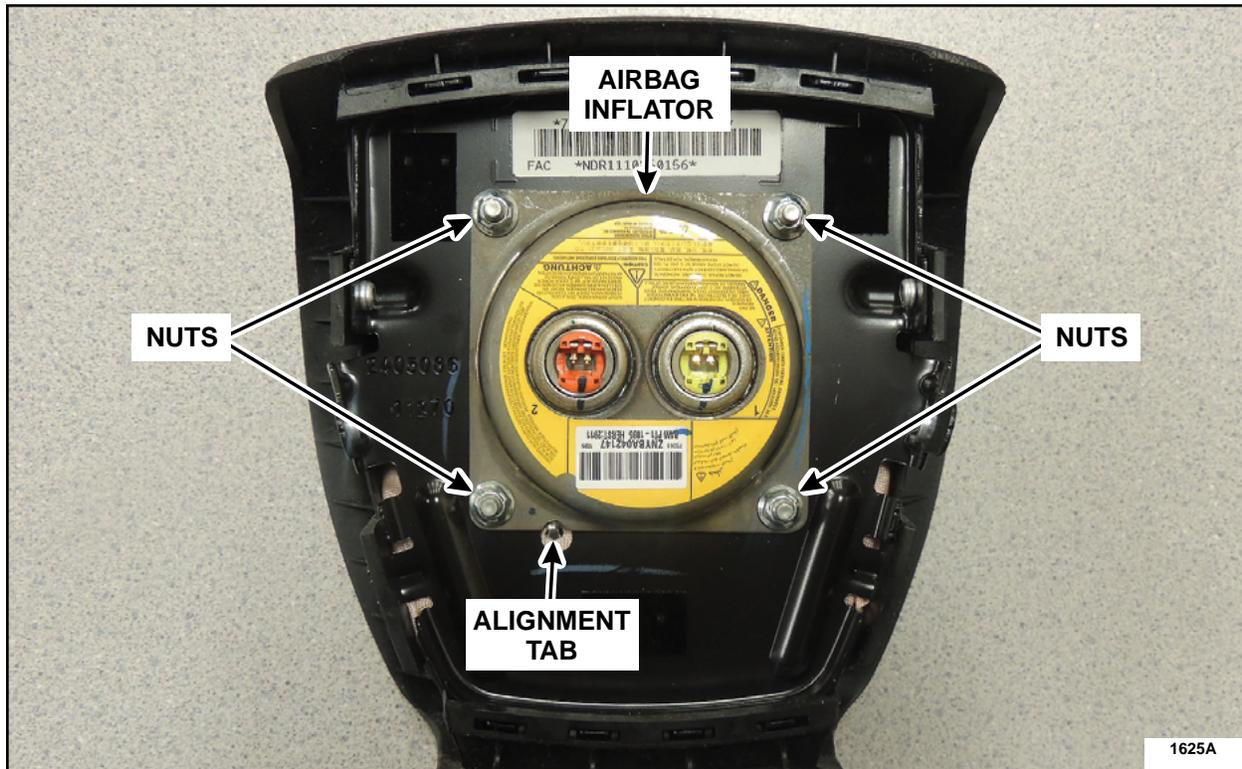


FIGURE 1

4. **NOTE:** In order to verify the correct airbag inflator is installed, mark the old airbag inflator with a felt tip marker prior to removal.

Remove the airbag inflator and set aside for return shipping. See Figure 1.

5. **NOTE:** The *new* airbag inflator must be installed in the same orientation as the original part.

Install the *new* inflator into the driver airbag. Verify the alignment tab on the airbag housing is aligned with the cut-out on the inflator. See Figure 1.

6. Install four *new* airbag inflator nuts onto the driver airbag. See Figure 1.

- Tighten to 6.5 Nm (57 lb-in).

7. Re-install the driver airbag. Please follow the WSM procedures in Section 501-20B.

NOTE: Confirm that the Airbag Readiness light still indicates no SRS faults are present.

8. Provide the part and packaging to the appropriate dealership personnel for return shipment to Takata.

NOTE: All original replaced airbag inflators must be returned to Takata Corporation. Each airbag inflator kit includes a return shipping label. Refer to the special return shipping instructions located in the packaging with the *new* airbag inflator. A copy of these instructions have been posted as Attachment IV for your convenience.



CUSTOMERS SATISFACTION PROGRAM 16B15 - UNIQUE PART RETURN SHIPPING INSTRUCTIONS

FEDEX GROUND SHIPMENT PREPARATION

As the shipper, you are responsible for proper packing and document completion. The person packaging the inflator must have received hazardous material training per 49CFR 172.702, and the training records must be on file at your dealership. The US Department of Transportation will impose substantial fines and/or penalties on the shipper if either packaging, labeling or documentation is not properly prepared and Customer Copy of OP 900PRP form is not kept on file for a minimum of 2 years.

IMPORTANT: Do not deploy any inflator. Return the used inflator within 1-2 business days. The person packing the used inflator must read and follow the provided instructions.

NOTE: Dealers in **Hawaii, Puerto Rico, and US Virgin Islands CANNOT** follow these shipping instructions. The dealer **MUST** contact the following Takata USA representative directly for shipping instructions: Miguel Prigadaa – Tel #: 210-250-5078 or Email: MLGTakataRestrains_International@menloworldwide.com

1. Shipping Documents

OP 900PRP Hazardous Materials Certification Form

FedEx Ground Shipping Label

FedEx Ground Shipping Envelope



5. Shipping Documentation Instructions (Cont.)

a) Fill in the following on the FedEx Copy and the customer copy:

- Shipper Name (dealer)
- Address
- CCN

b) Date the FedEx Copy and Customer copy (MM/DD/YY)

2. Packing Instructions

a) Confirm box is in acceptable condition. If a new box is needed, follow the New Box instructions located on the next page.

b) Place the un-deployed air bag inflator in the "cradle" of the box insert.



6. Shipping Documentation Instructions (Cont.)


a) Peel off the SHIPPER RECEIPT from the top of the FedEx Ground PRP Shipping label, place it in the Tracking ID box on the Customer Copy of the OP 900PRP form.

b) Peel off the RECEIPT & SHIPPER NUMBER from the top of the FedEx Ground PRP Shipping label, and place it in the Tracking ID box on the FedEx copy.



3. Closure Instructions

a) Close the top box flap, per box closure instructions located on front panel of box.

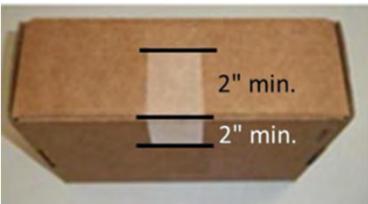

7. Shipping Documentation Instructions (Cont.)

a) Separate the FedEx Copy and Customer Copy of the OP 900PRP form. Keep the FedEx copy with the box. Attach the Customer Copy to the Repair Order.

Note: Dealers must retain the Customer Copy of OP 900PRP form in their records for 2 years.


Dealership Copy

4. Shipping Documentation Instructions

a) Separate the bottom 4 labels (OP 900PRP form), place them in the FedEx Ground envelope, remove the backing and firmly place on bottom side of box.



b) Peel off the Box Copy of the OP 900PRP form and firmly apply to the front side of the box.

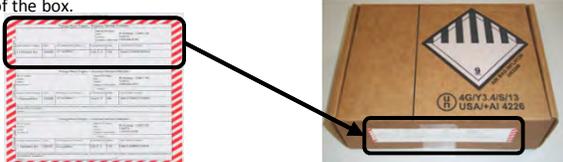

8. FedEx Ground PRP Shipping label


a) Fill in Shipper Name & Address in the upper section of the FedEx Ground Shipping label. Note: (RMA# is not required).

b) Peel off the backing of the FedEx Ground PRP Shipping label and affix to top of box to left of the Class 9 label.

- Use the scribe line on the box as a guide
- The FedEx Ground PRP Shipping label must not touch any portion of the printing to the right of the scribe line.

c) Provide the package and the FedEx Copy of The OP 900PRP form to the FedEx Ground Driver.

Note: If you don't receive regular pickups from Fed-Ex, call 800-463-3339 to schedule a pickup of the package.

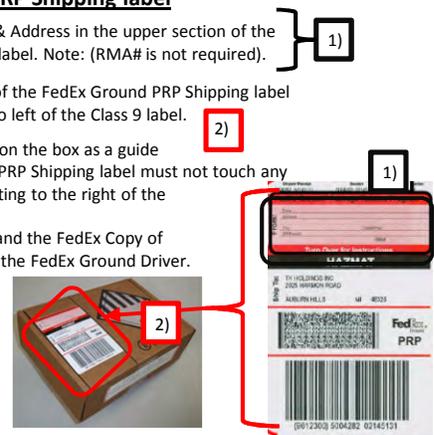

Requesting a New Box / Shipping Labels

If a new box or replacement shipping labels are needed, please contact a Takata USA representative listed below by phone or email to request replacement materials.

Primary Contact: **Miguel Prigadaa - Tel #: 210-250-5078**

E-Mail: MLGTakataRestrains_International@menlowworldwide.com

To help expedite your request, please be prepared to provide the following information:

a) Serial number on the original box

b) What Type of shipping material needed

- OP-900prp Hazardous Materials Certification Form
- FedEx Ground Shipping Label
- FedEx Ground Shipping Envelope

c) Dealer Shipping Information

- Contact name
- Dealer address
- Phone Number

