

	GROUP <b>General</b>	MODEL <b>2014-2017MY Soul (PS)</b>
	NUMBER <b>PS483</b>	DATE <b>June 2017</b>
 		
<b>SUBJECT:</b> HEADLIGHTS FLICKER/INTERMITTENTLY OPERATE OR REMAIN ON INDEFINITELY		

If a customer has a concern regarding intermittent flickering, inoperative headlights, or that the headlights stay on indefinitely after the vehicle is turned off, confirm the following actions have been performed, when applicable:

- A: TSB ELE 058 (SA164): **2014MY Only**
- B: TSB ELE 093 Headlamp bulb connector replacement (inspect for damaged connectors): **2014-2015MY Only**

For later model years or once the TSBs have been verified/completed on the vehicle model years listed in A and B above:

Note the headlight operation while repeatedly operating the multi-function switch by activating the following:

- On/Auto/Off switch,
- (**Note:** The headlight switch must be in the 'On' or 'Auto' position with the headlights on to do the next two (2) headlight flicker / intermittent operation evaluations.)
- RH/LH turn signals activation/cancelation, and
- HI/Low beam activation/cancelation (using different combinations).

In addition to the repeated operations/combinations, slightly twist the handle base to attempt duplicating the concern. If duplicated, replace the multifunction switch with a new assembly and verify proper operation of the headlights.