

LTB00837NAS2

TECHNICAL BULLETIN

03 FEB 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

307-01

SUBJECT/CONCERN:Transmission Cover Gasket Leak

AFFECTED VEHICLE RANGE:

| MODEL: | MODEL YEAR: | VIN: | ASSEMBLY PLANT: | APPLICABILITY: |
|-------------------------|--------------|----------------|-----------------|---|
| Discovery Sport (LC) | 2015 Onwards | 500116 Onwards | Halewood | Vehicles With: 9HP48 9-Speed Automatic Transmission - AWD |
| Range Rover Evoque (LV) | 2014 Onwards | 856580 Onwards | Halewood | Vehicles With: 9HP48 9-Speed Automatic Transmission - AWD |

MARKETS:NAS

CONDITION SUMMARY:**SITUATION:**

A fluid leak from the transmission, poor shift quality, and/or transmission noise may be evident.

CAUSE:

This may be caused by the transmission cover gasket having been damaged during manufacture, allowing transmission fluid to leak.

ACTION:

Should a customer express this concern, follow the Service Instruction below.

PARTS:

| PART NUMBER | DESCRIPTION | QUANTITY: |
|-------------|-------------|-----------|
|-------------|-------------|-----------|

| | | |
|----------|----------------------------------|---|
| LR081666 | ZF Transmission cover gasket kit | 1 |
| LR023288 | ATF Transmission fluid | 1 |

WARRANTY:
NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

| DESCRIPTION | SRO | TIME (HOURS) | CONDITION CODE | CAUSAL PART |
|---------------------------------------|----------|--------------|----------------|-------------|
| Transmission cover gasket - Renew | 44.20.28 | 0.7 | 42 | LR072666 |
| Lubrication system - Check and top up | 44.24.06 | 0.7 | 42 | LR072666 |

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

- 1 Install a new transmission cover gasket (see TOPIx Workshop Manual section 307-01: Automatic Transmission/Transaxle - Transmission Cover).
- 2 Check transmission fluid level (see TOPIx Workshop Manual section: 307-01 - Automatic Transmission/Transaxle - Transmission Fluid Level Check).
 - 1 Top up as required with ATF Transmission fluid (LR023288).

