

Reference	SSM73144
Models	Range Rover / L405 Range Rover Sport / L494
Title	Stability Control And Hill Descent Control Not Available Message Displayed
Category	Electrical
Last modified	01-Feb-2017 00:00:00
Symptom	206000 Warning Indicators

Content **Issue:** A customer may report an intermittent concern for Range Rover and Range Rover Sport 16MY only, where the Instrument Cluster Message Centre displays 'Stability Control Not Available' and 'Hill Descent Control (HDC) Not Available' when the ignition is switched on. The message will clear at the next ignition cycle. When the concern is present the Diagnostic Trouble Code (DTC) U0140-87 is stored in the ABS module.

Cause: The ABS module has a 15 second window to receive the CCF data which is currently taking 16.5 seconds when the ignition is switched on.

Action: Using Symptom Driven Diagnostics SDD with DVD 148.04 or later. Download the As-built data to the Car Configuration File and clear the DTC.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.