

LTB01002NAS2

TECHNICAL BULLETIN

18 MAY 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

501-08: Exterior Trim and Ornamentation

SUBJECT/CONCERN:

'A' Pillar Finisher Rubber Seal Adrift

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover Evoque (LV)	2012-2014	600001-799999	Halewood
Range Rover Evoque (LV)	2014-2015	900000-999999	Halewood
Range Rover Evoque (LV)	2014-2017	000001-203731	Halewood

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

The 'A' Pillar finisher rubber may be adrift or a wind noise from the front windshield area may be evident.

CAUSE:

This may be caused by the manufacturing process deviating from standard, causing the adhering process to not be as efficient as required.

ACTION:

Should a Customer express this concern, follow the Service Instruction below.

PARTS:**NOTE:**

'A' Pillar finisher may also be referred to as 'A' Pillar moulding in TOPlx.

PART NUMBER	DESCRIPTION	QUANTITY:
LR077218	Exterior 'A' Pillar finisher LH Black	1
LR077217	Exterior 'A' Pillar finisher RH Black	1
LR002162	4.8mm x 20mm Cross Recess Drive	2
RYH500840	M4 Plastic Nut	2
LR033144	HC1 Clip	10
LR002229	Grommet	10

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

NOTE:

'A' Pillar finisher may also be referred to as 'A' Pillar moulding in TOPlx.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPlx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Moulding - Windshield - Left side - Renew	76.43.39	0.1	D8	LR077217
Moulding - Windshield - Right side - Renew	76.43.40	0.1	D8	LR077217

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

NOTE:

'A' Pillar finisher may also be referred to as 'A' Pillar moulding in TOPlx.

-
- 1 Remove and discard the affected 'A' Pillar finisher (see TOPlx Workshop Manual section 501-08: Exterior Trim and Ornamentation - A-Pillar Moulding).
-



Visually inspect the date printed on the label attached to the new 'A' Pillar finisher.

- If the printed date is **25/11/16** or later, the part can be installed. Go to step 3.
- If the printed date is **24/11/16** or earlier, the part must not be installed.
 - Source a new 'A' Pillar finisher with a printed date of **25/11/16** or later.
 - Go to Step 3.

-
- 3 Install the new 'A' Pillar finisher (see TOPIx Workshop Manual section 501-08: Exterior Trim and Ornamentation - A-Pillar Moulding).

-
- 4 Repeat steps 1-3 for the other 'A' Pillar finisher if required.