

<b>Reference</b>	SSM73332
<b>Models</b>	Discovery / L462
<b>Title</b>	L462 All New Discovery Head Lamp Poor Profile
<b>Category</b>	Body
<b>Last modified</b>	16-May-2017 00:00:00
<b>Symptom</b>	108000 Ext. Trim/Accessories
<b>Attachments</b>	L462 Poor headlamp profile.pdf (L462 Poor headlamp profile.pdf)

**Content****Issue:**

Land Rover Discovery (L462) prior to the vin of LR008316, Customers or Retailers may report that the Headlamp Profile to the fender (Wing) or the Headlamp to Grille / Bumper profile is incorrect – see attached file for examples

**Cause:**

Concerns within the build process

**Action:**

Should a customer or retailer report that the profile of the Headlamp to the Grille / Bumper is incorrect then the Technician is requested to first loosen the 3 Headlamp fixings as shown in the attached file and then gentle push inwards on the headlamp until flush or within the standard of 2mm + or – 1.7mm. If this fails to align the profile then please replace the affected headlamp mounting bracket

**Part Numbers**

LR086096 –Right Hand Bracket, Headlamp Mounting

LR086097 – Left Hand Bracket, Headlamp Mounting

Should a customer or retailer report the Headlamp profile to the Fender / Wing then the Technician is requested to replace the affected Bumper Mounting Bracket

**Part Numbers**

LR104987 – Right Hand Bracket, Bumper Mounting

LR104988 - Left Hand Bracket, Bumper Mounting


Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.

# 3 Headlamp Fixings and Headlamp Bracket

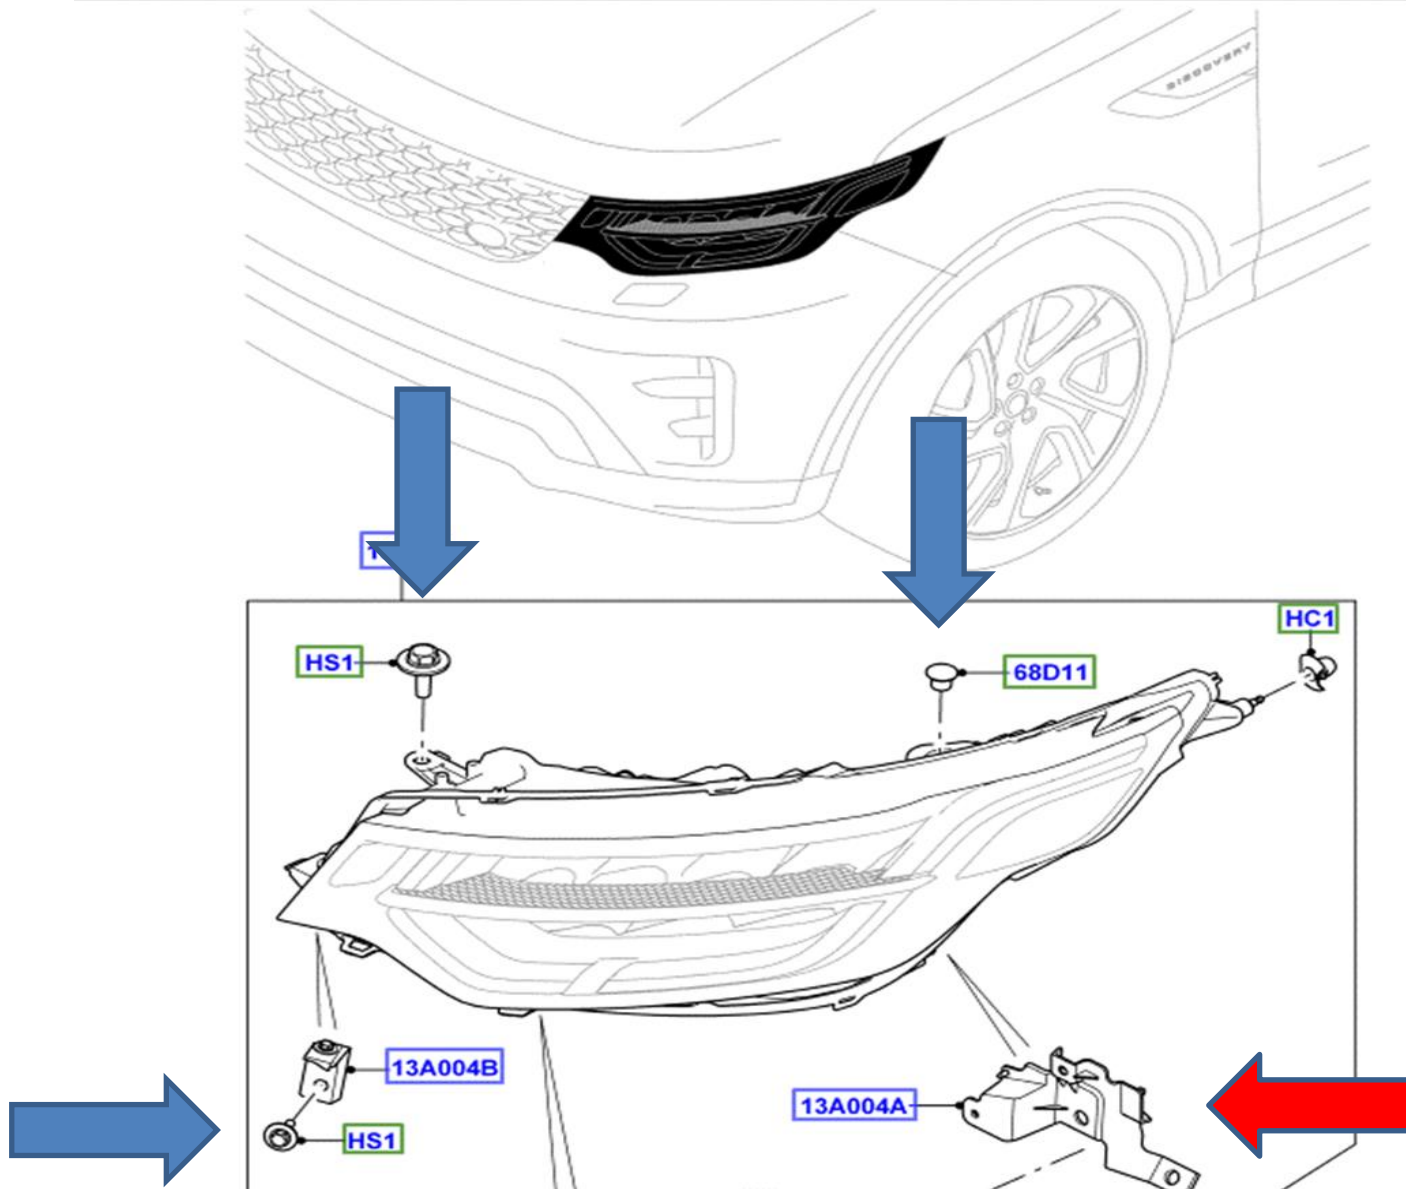

# Example of Poor Profiles

