

LTB00968NAS2

TECHNICAL BULLETIN

26 MAY 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

SECTION:

310-01: Fuel Tank and Lines

SUBJECT/CONCERN:

Fuel Tank Difficult To Fill

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
Range Rover Sport (LW)	2015-2016	504538-599999	Solihull	V6 S/C 3.0L Petrol /V8 S/C 5.0L Petrol
Range Rover Sport (LW)	2016-2017	100001-150686	Solihull	V6 S/C 3.0L Petrol /V8 S/C 5.0L Petrol
Range Rover Sport (LW)	2015-2017	600188-685778	Solihull	V6 S/C 3.0L Petrol /V8 S/C 5.0L Petrol
Range Rover (LG)	2015-2017	197044-349716	Solihull	V6 S/C 3.0L Petrol /V8 N/A 5.0L Petrol/V8 S/C 5.0L Petrol

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

The fuel tank may be difficult to fill.

CAUSE:

This may be caused by the fuel filler pipe design being restrictive.

ACTION:

Should a Customer express this concern, follow the Service Instruction below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY:
LR093763	Fuel Filler Pipe	1
TYG500130	Driveshaft Bolts	4
LR044836	Air line Connector	2
LR038196	Bolt	2
LR051047	Bolt	4
LR034277	Nut	2

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Filler neck - Renew - Range Rover Sport (L494; V6 3.0L S/C Petrol; V8 5.0L S/C Petrol); Range Rover (L405; V8 5.0L S/C Petrol)	19.55.07	7.2	55	LR062455
Filler neck - Renew - Range Rover (L405; V6 3.0L S/C Petrol)	19.55.07	7.3	55	LR062455

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

1 Refer to Special Service Message (SSM) SSM72957.

- Continue to Step 2 only if necessary.

2 Remove and discard the fuel filler pipe (see TOPlx Workshop Manual section 310-01: Fuel Tank and Lines).

3 Install the new fuel filler pipe (LR093763) (see TOPlx Workshop Manual section 310-01: Fuel Tank and Lines).