

Date	Expiration	Release	Page
06.2017	06.2019	0	1(4)

DRIP GUARD ADDITION - FRONT COMPARTMENT

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, bus washing operations can result in water dripping into the front service compartment. Add a drip guard above the entrance door valve.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS <i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>		
Model	VIN	Fleet Number
X3-45 Commuter Model Year : 2014 - 2016	The following vehicles 2PCG33495 <u>EC735590</u> , 2PCG33498 <u>EC735602</u> . And from 4RKG33499 <u>F9737002</u> up to 4RKG33491 <u>G9737299</u> incl.	From 2490 up to 2789 , incl.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.		

MATERIAL NEEDED

Order kit number SP17-312 which includes the following parts:

Part No.	Description	Qty
140094	Drip guard / Protector	1

NOTE
<i>Material can be obtained through regular channels.</i>

Date	Expiration	Release	Page
06.2017	06.2019	0	2(4)

PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

1. Before performing bulletin, pump the brakes down to deplete the primary and secondary air reservoirs.

2. Locate and open the Front Service Compartment Door. (Figure 1)

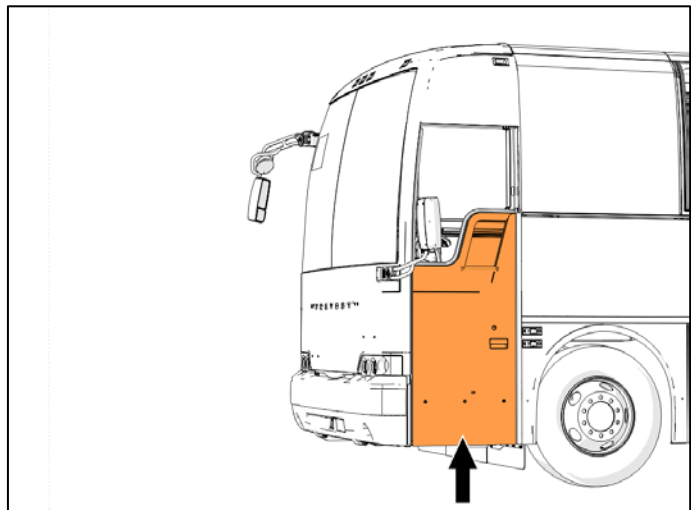


Figure 1

3. Open the drain valve (clockwise) on the bottom of the accessory filter to drain the accessory system

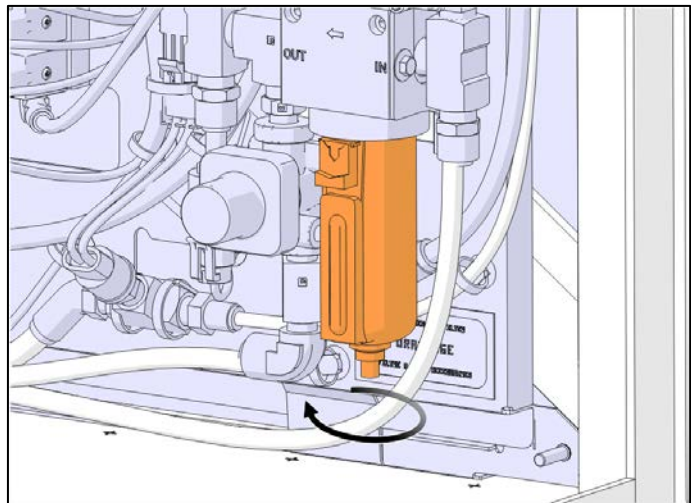


Figure 2: Accessory System Drain

Date	Expiration	Release	Page
06.2017	06.2019	0	3(4)

4. On the air distributor mounting bracket, loosen the left screw a few turns.

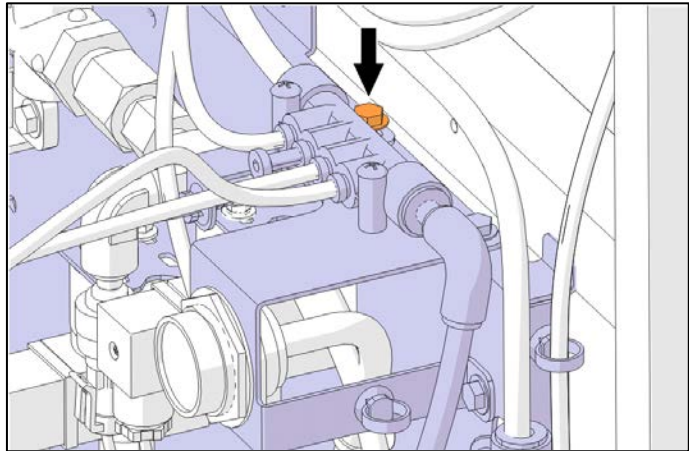


Figure 3: Loosen left screw

5. Insert drip guard under distributor mounting bracket.

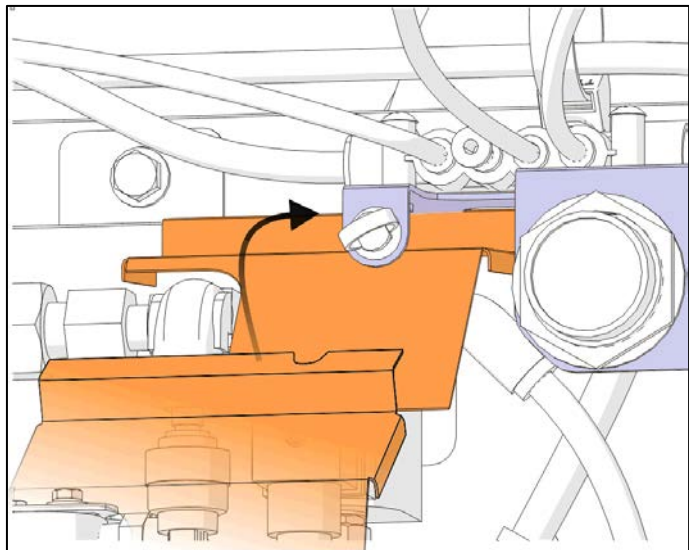


Figure 4: Slide in

6. Tighten screw to **7 lb-ft.**

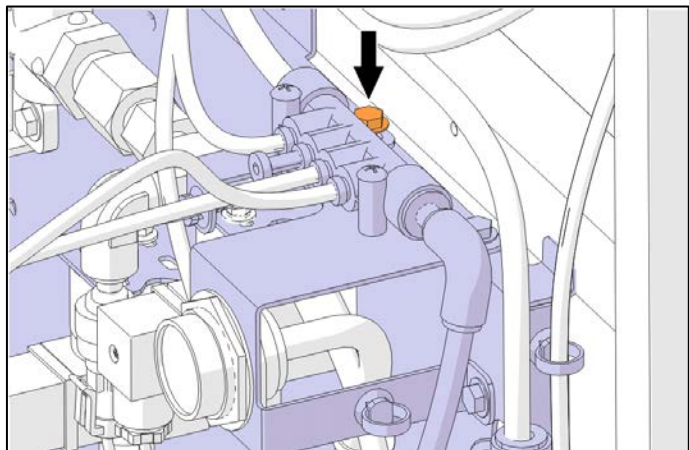


Figure 5: Tighten screw

Date	Expiration	Release	Page
06.2017	06.2019	0	4(4)

PARTS / WASTE DISPOSAL

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately 15 minutes.

OTHER

VBC Bulletin	N/A
Fail Code	18.01
Defect Code	09
Syst. Cond	B
Causal Part	562848

Access all our Service Bulletins on
<http://techpub.prevostcar.com/en/>

or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type
"ADD" in the subject to receive our warranty bulletins by e-mail.



Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.