

Please perform SP17-20: Reprogram ESP on H3-41

NO parts & NO publication required - Follow instructions below:

ELECTRONIC STABILITY PROGRAM MAY NOT OPERATE PROPERLY.
BRAKES APPLIED ON CERTAIN WHEELS WHEN NOT REQUIRED.
ACTIVE ESC CODES IN DASH (STEERING ANGLE)
H3-41 MODELYEAR 2016 2017
BAD WHEELBASE PARAMETER

INSTRUCTIONS:

- REPROGRAM BENDIX EC-60 WITH ESP.
- THEN WITH ACOM SOFTWARE RECALIBRATE SAS (STERRING ANGLE SENSOR) AND LATERAL ACCELERATION SENSOR.
- CLEAR FAULT CODES.
- IDEALLY: PERFORM ROAD TEST WITH TIGHT TURNS ABOVE 30KM/h (19MPH).

VBC campaign:

Fail Code: 12.02
Defect Code: 49
System condition: B
Causal Part: 640010
Estimate (total): 0.00
Estimate (labor hours): 0.00
Estimate (sublet cost): 0.00