



Service Bulletin


TECHNICAL

Subject: Active Shutters Inoperative, Malfunction Indicator Lamp (MIL) Illuminated

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
				from	to		
Buick	LaCrosse	2017	2017				
Chevrolet	Malibu (VIN Z)	2016	2017				

Involved Region or Country	North America and Israel
Additional Options (RPO)	VRI
Condition	<p>Some customers may comment on the Malfunction Indicator Lamp (MIL) being illuminated. The Technician may find one or more of the following DTCs set:</p> <ul style="list-style-type: none"> • P059F • U1501 • U1510 • U1511
Cause	<p>This condition may be caused by the following conditions:</p> <ul style="list-style-type: none"> • Moisture intrusion in the B9, M60B and/or X119 connector for the Ambient Air Temperature Sensor Wiring Harness. • Snow and/or ice buildup in the front lower grille area of the vehicle, which could prevent the active aero shutters from opening or closing.

Correction

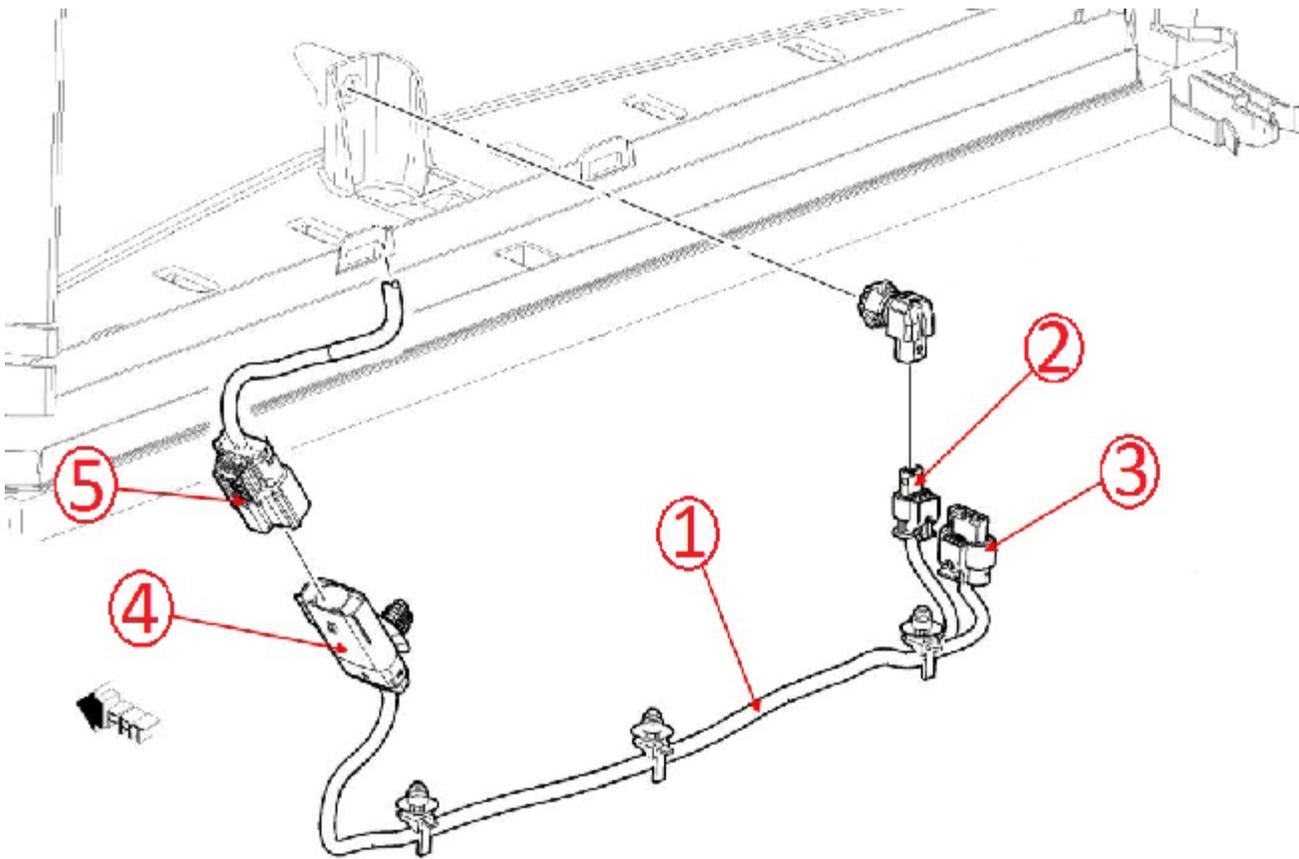

Inspect the Ambient Air Temperature Sensor Wiring Harness connectors B9 (2), M60B (3) and the X119 (4, 5) for any signs of corrosion.

- If any corrosion was found on the Ambient Air Temperature Sensor Wiring Harness (1), it must be replaced.
- If the corrosion was found at the X119 connector (5), the main body wiring harness connector must be repaired as needed.
- If the corrosion was found on the B9 connector (2), the Ambient Air Temperature Sensor must be replaced.
- If the corrosion was found on the M60B connector (3), the active shutter must be replaced.

If the above inspection did not find any corrosion and there are signs of previous snow or ice in the Active Shutter system, explain to the customer that this can occur during certain weather conditions and the MIL will clear when the shutters are in working proper order. It will not impact the designed performance or reliability of the vehicle. Please share this information with the customer, including a copy of this bulletin.

Parts Information

Description	Part Number	Qty
CONNECTOR KIT, WRG HARN	13504371	1
HARNES, AMB AIR TEMP SEN WRG	23258243	1

Warranty Information

Labor Operation	Description	Labor Time
5430860	Connector Kit Replacement	Use Published Labor Operation Time
5480328*	Ambient Air Temperature Sensor Wiring Harness - Replacement	0.5 hr

*This is a unique Labor Operation for Bulletin use only.

Version	3
Modified	August 11, 2016 – Added DTCs and added Ambient Harness and repair. Feb. 7, 2017 – Adding the 2017 Model Year for Malibu and LaCrosse model.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION