



Service Bulletin

TECHNICAL

Subject: Front Floor Console Armrest Latch Inoperative

Brand:	Model:	Model Year:		Date Breakpoint:		Engine:	Transmission:
		from	to	from	to		
GMC	Acadia (VIN N)	2017	2017	SOP 2017	Prior to September 1, 2016	All	All

Involved Region or Country	North America, Middle East
Condition	Some customers may comment that the front floor console door/armrest will not latch and/or stay closed.
Cause	The cause of the condition may be a flashing in the latch plastic housing, which does not allow the spring retention tab to fully seat. When the spring tab height is at the lower end of the spec, there is insufficient overlap to retain the spring.
Correction	Replace the floor center console latch assembly.


Parts Information

Description	Part Number	Qty
LATCH ASM-F/FLR CNSL A/RST	84038347	1

Warranty Information

Labor Operation	Description	Labor Time
1033580	Front Floor Console Armrest Latch Replacement	Use Published Labor Operation Time

Service Procedure

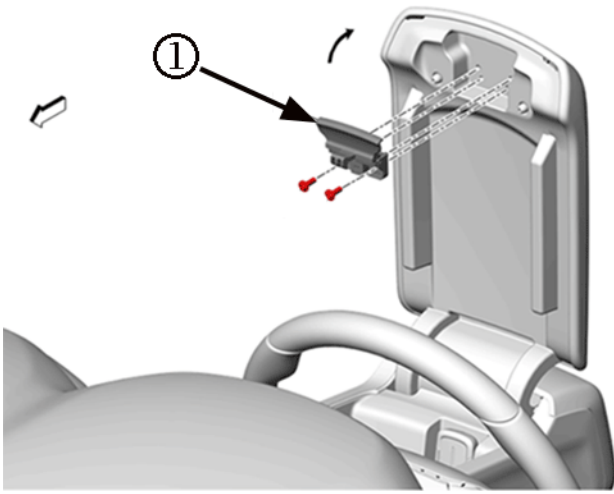

Important: During replacement of the latch, ensure the fasteners are tightened to the torque specification noted in the SI procedure.

Replace the front floor console armrest latch (1). Refer to *Front Floor Console Armrest Latch Replacement* in SI.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION