



Preliminary Information

PIT5489C Clunk Or Rattle Noise From Steering Over Bumps

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|----------|--------------|------|-----------------------------|---------|----------------|
| | | | from | to | | |
| Chevrolet | Colorado | 2015 - 2016 | SOP | Built Before April 30, 2016 | All | All |
| GMC | Canyon | 2015 - 2016 | SOP | Built Before April 30, 2016 | All | All |

Supersession Statement

This PI was superseded to add a break point date to the Models section, please discard all copies of PIT5489B.

Condition / Concern

The customer may state there is a rattle or clunk noise from the front of vehicle over bumps. The technician may isolate this noise to the lower steering intermediate shaft.

Recommendations / Instructions

Engineering has released a redesigned lower intermediate shaft for this noise concern. Replace the lower intermediate shaft with the part number listed below.

Parts Information

| Part Number | Description | Qty |
|-------------|--------------------------|-----|
| 84039333 | Lower Intermediate Shaft | 1 |

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|-----------------|----------------------------|--------------------------|
| 7441280 | Replace Intermediate Shaft | Use Published Labor Time |

