## June 29, 2017

06959 Version 3

# Audio Unit Software Update

HONDA

Supersedes 17-048, dated June 20, 2017, to revise the information highlighted in yellow

## **AFFECTED VEHICLES**

#### NOTE: 5-door Civics (Hatchback) are not affected.

Year	Model	Trim	VIN Range
2016	Civic	EX, <mark>EX-T</mark> , Touring	ALL

#### **REVISION SUMMARY**

Under AFFECTED VEHICLES, the trim level was revised.

### **SYMPTOM**

There is a problem with the audio unit software, which may lead to one or more of the following symptoms:

- Bluetooth<sup>®</sup> Audio skips.
- There is no sound from Apple CarPlay<sup>™</sup> after connecting *Bluetooth*<sup>®</sup>, then USB.
- Cannot turn on Bluetooth<sup>®</sup>.
- *Bluetooth*<sup>®</sup> turns off or disconnects by itself.
- Starting vehicle causes *Bluetooth*<sup>®</sup> to disconnect.
- Bluetooth<sup>®</sup> Audio sound will skip when receiving phone calls.
- There are pairing problems with *Bluetooth*<sup>®</sup> HandsFreeLink<sup>®</sup>(HFL).
- Pandora<sup>®</sup> does not play after HFL call ends.
- GPS error code 1302 sets.
- GPS initialization screen appears.
- GPS shows inaccurate vehicle location.
- Android Auto<sup>™</sup> will not play.
- Voice commands do not work.
- Error message SXM check tuner appears.

- System does not recognize "SXM" in voice commands.
  - Rear camera is stuck on in Park.
  - Rear camera image does not display when transmission is shifted to Reverse.
  - LaneWatch<sup>®</sup> image will not display.
  - Audio power button does not work.
  - Home screen does not display app icons.
  - Screen locks and/or check tuner message appears.
  - Clock does not match between audio display and dashboard meter.
  - Incoming call screen stays on after ending the call.
  - HFL voice repeats the ALPHABET.

#### **CORRECTIVE ACTION**

Update audio unit software using the audio-navigation system update device.

#### WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation	Description	Flat Rate	Defect	Symptom	Template	Failed Part
Number		Time	Code	Code	ID	Number
0100A1	Update the audio unit software.	0.3 hr	03214	03217	17-048A	39101-TBA-A21

Skill Level: Repair Technician

**CUSTOMER INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

Tool Name	Part Number
Audio-Navigation System Update Device (purple USB update tool)	07AAU-TBAA1A0



#### **REPAIR PROCEDURE**

#### NOTE:


- Do not turn the ignition/engine off until the update is complete.
- Do not remove the USB during the update.
- Do not insert the USB update device into a computer. It may be corrupted and no longer function.
- Advise the customer that all user memory, including audio presets and *Bluetooth<sup>®</sup>* pairing profiles, will be erased as part of the update.
- 1. Write down the customer's audio presets so they can be re-entered after the update is completed.
- 2. Prepare the vehicle for the update.
  - If the engine will be running, park the vehicle outside in a well ventilated area or attach an appropriate exhaust vent. Go to step 3.
  - If the engine will not be running, connect an active charger to the battery. Go to step 4.
- 3. Start the engine, and leave it running throughout the entire software update process. Go to step 5.
- 4. Push the Engine Start button twice to turn the Ignition to ON (not Accessory mode).
- 5. Let the audio system boot up to the home screen.



Plug the purple USB update device into the USB port below and behind the audio unit near the driver's knee area.
NOTE: The previous orange USB tool (p/n 07AAZ-TBAA100) is to be destroyed and replaced by the new purple tool.



7. Depending on the current audio software after 50 seconds, you will either see a blank display and the system will reboot or you will see the following update message, Select **Yes**.

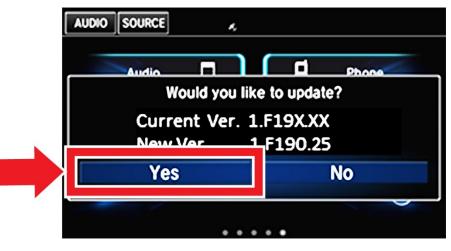

8. After the system reboots, the software update should start. It takes up to 20 minutes to complete the update. Once you start the update, you do not have to stay with the vehicle.

Softwa	are Upda	te
	Current New	Ver. 1.F186.69 Ver. 1.F190.25
		Copying not turn off the vehicle nect the USB device.


NOTE: After the update has completed, the system will reboot automatically. If the Lost Power message appears, press and hold the power button for 2 seconds to enable the system. The GPS screen may appear and will disappear once the GPS is received.



9. Press and hold the Day/Night, Audio Power, and MENU buttons at the same time.



# 10. Select Detail Information & Setting.

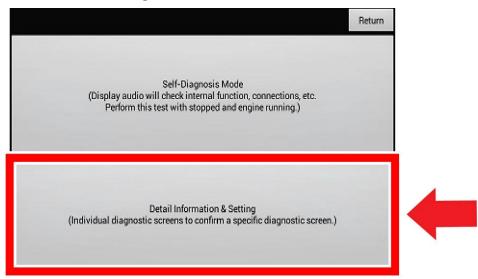

### 11. Select Version.

	Return	
Monitor Check	B-CAN	
Unit Check	F-CAN	_
Audio Check	Version	
Guideline Setup	Vehicle status	
Functional Setup	GPS Information	

- 12. Scroll all the way to the bottom to: **Software loader** and **System μCom** and check the versions. The software should be updated to the following versions:
  - Software loader : 1.F190.25
  - System μCom : H6XF00.XX.E2.XX (the X values are different depending on model)



13. After verifying the software has been updated, select **Return** to return to the **Detail Information** and **Setting** screen.

	HUL G2P Engine 20
	HUL TTS Engine1.0.2
	VehicleDbManager1.0
	com.mitsubishielectric.ada.util.vehiclerw4.2.2-15 4
DBOOT	1.9_20160329042950
Software loader	1.F190.25
System µCom	H6XF00.XX.E2.XX


# 14. Select Unit Check.

	Return
Monitor Check	B-CAN
Unit Check	F-CAN
Audio Check	Version
Guideline Setup	Vehicle status
Functional Setup	GPS Information


# 15. Select Error History.

F-CAN	Return
B-CAN	1
USB	-
Vehicle status	-
HFT/Mic	
Hard Key	
Error history	


16. Select Hard Error.

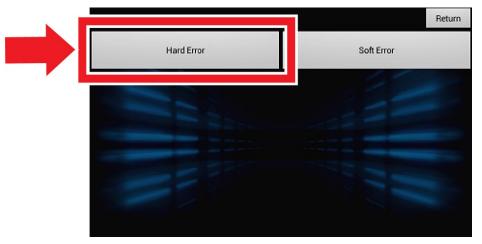


17. Select Clear.

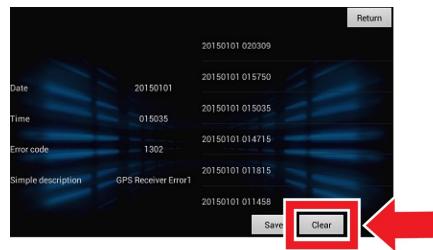

18. Select Yes.

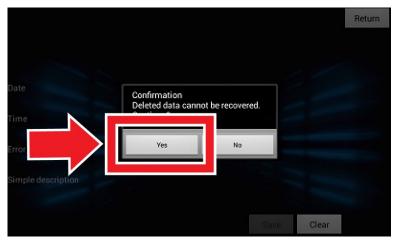

19. Select **Return** 5 times to go back to the home screen.

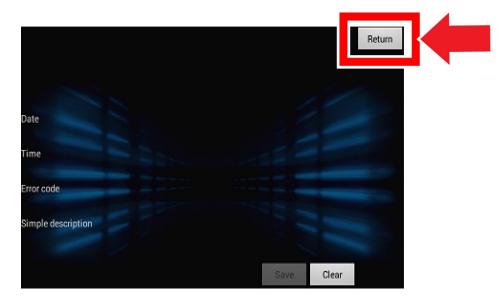

- 20. Remove the USB device.
- 21. The vehicle is now updated.

END