HONDA

Service Bulletin

June 30, 2017

06948 Version 2

Charging System Indicator Is On with DTC P154A

Supersedes 16-026, dated March 4, 2016; See REVISION SUMMARY

AFFECTED VEHICLES

Year	Model	Trim	VIN Range		
2015	Fit	ALL	ALL		
2016	Fit	ALL	3HGGK5GM7000001 thru 3HGGK5GM701651		
2016	HR-V	2WD	3CZRU5GM7000001 thru 3CZRU5GM715111		
2016	HR-V	4WD	3CZRU6GM7000001 thru 3CZRU6GM719915		

REVISION SUMMARY

2013–15 Accord vehicles were removed from this bulletin and moved to service bulletin 17-057, 2013–16 Accord Battery Management Sensor.

SYMPTOM

The Charging System indicator is on with DTC P154A (battery sensor internal failure).

POSSIBLE CAUSES

The battery sensor has an internal failure.

CORRECTIVE ACTION

Replace the battery sensor.

PARTS INFORMATION

Part Name	Part Number	Quantity
Battery Sensor (Fit and HR-V)	38920-T5A-A02	1

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

For 2013-15 Accords only: If you did the repair in this S/B on or before June 30, 2017 (RO date), use the Warranty Claim Information provided below. For any repairs done after June 30, 2017, refer to S/B 17-057, Safety Recall: Battery Sensor.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
7101B2	Replace the battery sensor. Includes DTC check. (Fit and HR-V)	0.4 hr	03217	03214	16-026A	38920-T5A-A02
7101B2	Replace the battery sensor. Includes DTC check. (Accord)	0.4 hr	03217	03214	16-026B	38920-T2A-A03

Skill Level: Repair Technician

 
DIAGNOSIS

- 1. Turn the ignition to ON.
- 2. Clear the DTC with the HDS and wait 5 seconds.

Is DTC P154A indicated? **YES**: Go to step 3. **NO**: This bulletin does not apply. Continue with normal troubleshooting.

- 3. Turn the ignition to OFF.
- 4. Disconnect the 12-volt battery sensor 3P connector.
- 5. Measure the voltage between test points 1 and 2.


Test condition	Vehicle OFF (LOCK) mode.
	12-volt battery sensor 3P connector disconnected
Test point 1	12-volt battery sensor 3P connector No. 1
Test point 2	Body ground



Is there battery voltage? **YES**: Go to REPAIR PROCEDURE. **NO:** This bulletin does not apply. Continue with normal troubleshooting.

REPAIR PROCEDURE

- 1. Make sure the ignition is turned to OFF.
- 2. Disconnect the connector.

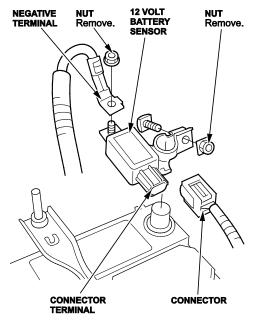


3. Remove the 12-volt battery sensor from the 12-volt battery.

NOTE: To protect the 12-volt battery sensor connector from damage, do not hold it when removing the terminal.

- 4. Disconnect the terminal from the 12-volt battery sensor.
- 5. Install the 12-volt battery sensor to the 12-volt battery.

NOTE:

- Make sure the areas between the negative terminal and the battery sensor are clean.
- To protect the connector from damage, do not hold it when removing the terminal.

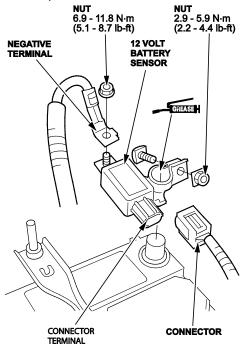

- 6. Connect the connector.
- 7. Apply multipurpose grease to the terminals to prevent corrosion.