

Reference	SSM73332
Models	Discovery / L462
Title	L462 All New Discovery Head Lamp Poor Profile
Category	Body
Last modified	28-Jun-2017 00:00:00
Symptom	108000 Ext. Trim/Accessories
Attachments	1L462 Poor headlamp profile.pdf (1L462 Poor headlamp profile.pdf)

Content **Issue:**

Land Rover Discovery (L462) prior to the vin of LR008316, Customers or Retailers may report that the Headlamp Profile to the fender (Wing) or the Headlamp to Grille / Bumper profile is incorrect – see attached file for examples

Cause:

Concerns within the build process

Action:

Should a customer or retailer report that the profile of the Headlamp to the Grille / Bumper is incorrect then the Technician is requested to first loosen the 3 Headlamp fixings as shown in the attached file and then gentle push inwards on the headlamp until flush or within the standard of 2mm + or – 1.7mm.

Should a customer or retailer report the Headlamp profile to the Fender / Wing then the Technician is requested to replace the affected Bumper Mounting Bracket

Part Numbers

LR104987 – Right Hand Bracket, Bumper Mounting
LR104988 - Left Hand Bracket, Bumper Mounting

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.