

Reference	SSM73446
Models	Discovery Sport / L550 Range Rover Evoque / L538
Title	L538 & L550 14MY Onwards - Driveline noise concerns
Category	Driveline
Last modified	28-Jun-2017 00:00:00
Symptom	597997 Driveline Noise Concerns

Content

Issue:

L538 & L550 vehicles 14MY Onwards with Active Driveline may exhibit a buzzing type noise from the driveline which may be more noticeable at low speeds ie - cornering. This may or may not be accompanied by a 4WD error message displayed on the Instrument cluster message centre.

Cause:

JLR suspect low level of hydraulic fluid in the Active driveline system may be generating the noise.

Action:

If a customer presents their vehicle exhibiting the above noise please check the Active driveline hydraulic system for leaks.

- If any leaks are found please repair as necessary using Topix and submit an EPQR.
- If no leaks are found please carry out the Hydraulic System Filling and Bleeding procedure as stated in Topix. (41.25.07)

If this rectifies the customers concern please return the vehicle to the customer and submit an EPQR.

If this does not rectify the customers concern continue to diagnose as necessary and raise a Technical Assistance Request if required.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.