

Classification: Reference: COPYRIGHT® NISSAN NORTH AMERICA, INC.

Date:

EC16-035a ITB17-042a August 21, 2017

INFINITI; DTC P0456 CAUSED BY EVAP LEAK AT VENT CONTROL VALVE O-RING

This bulletin has been amended. The APPLIED VEHICLES and CLAIMS INFORMATION sections have been revised.

No other changes have been made. Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2011-2012 G25 Sedan (V36) 2015 Q40 (V36)

2007-2008 G35 Sedan (V36) 2014-2018 Q50 (V37)

2009-2013 G37 Convertible (V36) 2014-2018 Q50 Hybrid (V37) 2008-2013 G37 Coupe (V36) 2014-2015 Q60 Convertible (V36) 2009 G37 Sedan (V36) 2014-2015 Q60 Coupe (V36)

2006-2010 M45/M35 (Y50) 2014-2018 Q70 (Y51)

2011-2013 M37/M56 (Y51) 2014-2018 Q70 Hybrid (Y51) 2004-2010 QX56 (JA60) 2017-2018 QX30 (H15) 2011-2013 QX56 (Z62) 2014-2017 QX50 (J50)

2014-2017 QX60 (L50)

2014-2017 QX60 Hybrid (L50)

2014-2017 QX80 (Z62)

IF YOU CONFIRM

The MIL is ON in an APPLIED VEHICLE with DTC P0456 (EVAP VERY SML LEAK)

AND

- DTC P0456 is not caused by a loose fuel fill cap (refer to ITB13-044).
- An EVAP leak has been detected where the vent control valve mounts to the canister.
- The vent control valve O-ring seal is determined to be the cause.

ACTION

- 1. **DO NOT REPLACE** the vent control valve.
- 2. Replace the vent control valve **O-ring seal** (O-ring).
 - Refer to SERVICE PROCEDURE on page 2.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You MUST closely follow the <u>entire</u> SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.


SERVICE PROCEDURE

- 1. Replace the O-ring.
 - To access the O-ring, refer to the appropriate section in the Electronic Service Manual (ESM) of the APPLIED VEHICLE for vent control valve removal and installation.
 - This O-ring is now available separately (see PARTS INFORMATION).
 - When installing, do not add any lubrication to the O-ring.
 - Seat the O-ring all the way down as shown on page 4, Figure 7.
 - ➤ Having the O-ring seated all the way down will assure it is not twisted or rolled over.
 - Refer to the pictures on pages 3 and 4 for additional installation information.

CAUTION:

- Make sure the surfaces that the O-ring comes in contact with are clean.
- ➤ When installed, make sure the O-ring is not twisted or rolled over.
- Verify the repair is complete by checking for leaks with a "smoke" leak detection machine or CONSULT-III plus (C-III plus).
 - If a "smoke" leak detection machine is used, follow the manufacturer's operating instructions.
 - ➤ If C-III plus is used:
 - 1. Confirm the fuel filler cap is secure.
 - 2. Connect Essential Tool J-42909 to the EVAP service port.
 - 3. Using Active Test, close the vent control valve.
 - 4. Apply pressure using J-42909 until the bar graph reaches about halfway.
 - 5. Monitor the bar graph for 10 minutes.

2/5 ITB17-042a

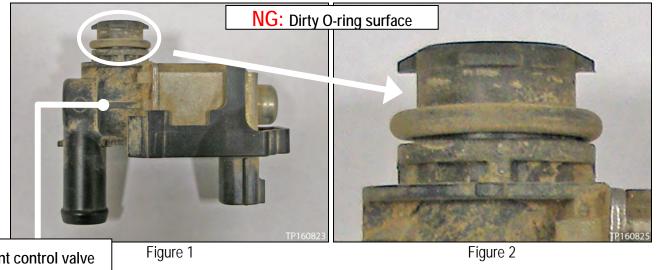

Vent control valve

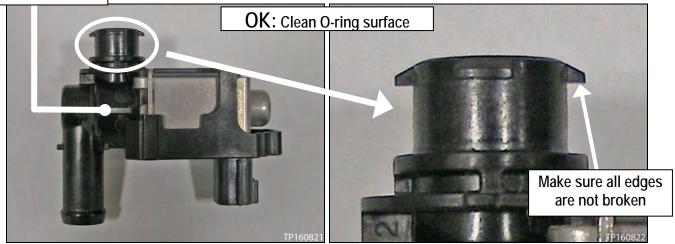


Figure 3 Figure 4

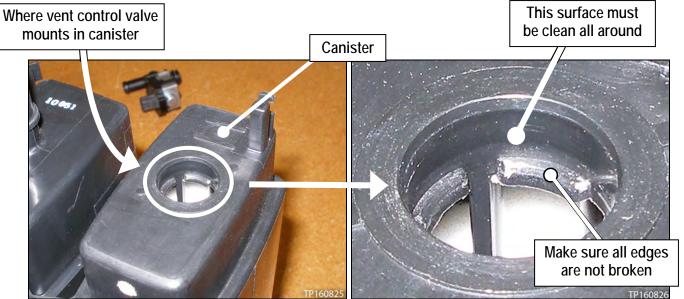


Figure 5 Figure 6

> 3/5 ITB17-042a

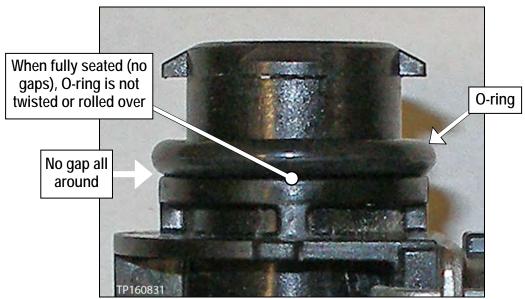


Figure 7

PARTS INFORMATION

DESCRIPTION	P/N	QUANTITY	
SEAL O-RING	16618-JF00A	1	

4/5 ITB17-042a

CLAIMS INFORMATION

Submit a Primary Part (PP) line claim using the following claims coding:

DESCRIPTION	MODEL	PFP	OP CODE	SYM	DIA	FRT
Replace Vent Control Valve O-Ring	M35/45 (Y50)					
	G35/37 (V36)	16618-JF00A	FX57AA	HD	32	0.3
	Q50 (V37) VHV					
	M35 HV/37/56, QX70 (Y51)					0.4
	Q50 (V37) VHR, QR, VR					
	QX50 (J50)					
	QX60 (L50)					
	QX30 (H15)					0.5
	QX56 (JA60)					

5/5 ITB17-042a