

Reference	SSM73249
Models	F-PACE / X761 XE / X760 XF / X260
Title	Coolant Leak At Reservoir Cap Post Containment
Category	Engine
Last modified	01-Mar-2017 00:00:00
Symptom	402000 Cooling System Concerns

Content Issue: Coolant leaking from coolant reservoir cap when the coolant system pressurizes due to thermal expansion.

Cause: This may be caused by a coolant reservoir filler neck that is out of round.

Action: Should coolant be found to be leaking from the reservoir cap, refer to TSB JTB00518NAS3 and measure the coolant reservoir filler neck. If the filler neck is found to be out of round or distorted replace both the reservoir and cap.

If the vehicle VIN is beyond the following containment VINs, please submit an EPQR and hold both the replaced coolant reservoir and cap for collection by Engineering to support investigation.

F-PACE (X761) VIN: 093015
XE (X760) VIN: 970403
XF (X260) VIN: Y43893

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.