



Preliminary Information

PIC6289 Noise From Exhaust Valves

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Camaro	2017	All	All	LT1, LGX	All
Involved Region or Country	United States, Canada, Mexico, United Kingdom, Sweden					
Additional Options (RPO)	N/A					
Condition	Some customers may comment on a Check Engine Light (CEL) or an exhaust noise. Upon further inspection, dealership technicians may find a P12FD or a P12F0 set.					
Cause	This concern may be caused by an exhaust actuator that was installed but the learn procedure was not completed. This concern will occur on new vehicles with low mileage, or on vehicles that recently had service work done to the exhaust system.					

Correction:

Dealership technicians are to relearn the Cylinder Deactivation Valves using GDS2 to resolve this concern. These valves are also referred to as the Active Fuel Management (AFM) valves. They are located before, or in front of, the muffler. Do not replace any parts for this concern.

Note: If the vehicle's battery becomes discharged or if it is disconnected for any reason, the Cylinder Deactivation Valves and/or Flow Control Valve relearn procedure may also need to be performed. If not, the exhaust valves may hunt or search for position and continue to make an audible noise.

Version History

Version	1
Modified	

