



# Technical Service Bulletin

---

## 01 MY16/17 2.0TFSI, MIL on, DTC P001600

01 17 04 2046377/2 February 27, 2017. Supersedes Technical Service Bulletin Group 01 number 17-00 dated February 13, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A5, A5 cabriolet, Q5	2016 - 2017	All	2.0TFSI
Q3	2016 - 2017	All	2.0TFSI

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (Added model year)
1	02/13/2017	Initial publication

- MIL on.
- **DTC P001600** (crankshaft camshaft correlation) stored in engine control module.
- Other DTC's can also be stored at the same time.

# Technical Service Bulletin

---

## Technical Background

On some MY 2016 and 2017 vehicles equipped with 2.0TFSI engines, engine codes (CPMB, CAED or CCTA), DTC P001600 can be set due to a worn intake side - camshaft bearing bridge thrust surface (Figure 1).



Figure 1. Worn thrust surface.

## Production Solution

Improved camshaft bearing bridge with 50% larger thrust surface in production starting 02/10/2017.

## Service

If DTC P001600 (crankshaft camshaft correlation) is stored in the engine control module memory, proceed as follows:

1. Measure the intake camshaft end play.
2. If intake camshaft endplay is *less than* 0.2mm this TSB **does not** apply, proceed with GFF to diagnose root cause.
3. If intake camshaft end play is *greater than* 0.2mm, proceed to step 4.
4. Replace the camshaft bearing bridge (Figure 2) with part number 06H 103 144 K (Figure 3, improved part).



**Note:**

Do not use *Part number 06H 103 144 J.*

# Technical Service Bulletin

---



**Figure 2.** Original Part *06H 103 144 J*.



**Figure 3.** Improved Part *06H 103 144 K*.

5. Drain engine oil, change the engine oil, and engine oil filter.



**Note:**

To prevent oil pan thread damage, only use torque wrench to tighten oil drain plug to 30Nm.

6. Check engine oil level and top up as needed.

7. Perform test drive to verify repair.



# Technical Service Bulletin

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	1584		
<b>Damage Code:</b>	0010		
<b>Q5, A5, and A5 cabriolet</b>			
<b>Labor Operations:</b>	Measure camshaft endplay	1505 9999	Max 30 TU
	Camshaft bridge remove and install	1584 1914	100 TU
	Change engine oil and filter	1701 9999	30 TU
<b>Diagnostic Time:</b>	GFF	0150 0000	Max 40 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2046377/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	1584		



# Technical Service Bulletin

<b>Damage Code:</b>	0010		
<b>Q3</b>			
<b>Labor Operations:</b>	Measure camshaft endplay	1505 9999	Max 30 TU
	Camshaft bridge remove and install	1584 1914	120 TU
	Change engine oil and filter	1701 9999	30 TU
<b>Diagnostic Time:</b>	GFF	0150 0000	Max 40 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2046377/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Part Number	Part Description	Quantity
06H 103 144 K	Camshaft bridge	01
06H 103 483 C Or 06H 103 483 D	Gasket <b>Replace only if damaged</b> Gasket	01
N 105 724 03 Or	Hexagon socket head bolt <b>Application dependent</b>	01



# Technical Service Bulletin

---

N 910 967 01	Hexagon socket head bolt	
06J 115 403 Q	Oil filter	01
N 911 679 01 Or N 013 815 7	Drain plug <b>Application dependent</b> Drain plug seal ring	01
	Engine oil	4.9 quart

## Additional Information

All parts and service references provided in this TSB (2046377) are subject to change and/or removal. Always check your service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.