

| | |
|----------------------|---|
| Reference | SSM73473 |
| Models | F-PACE / X761 XE / X760 XF / X260 |
| Title | Click noise from the front of vehicle during steering (with wheels on the ground) |
| Category | Chassis |
| Last modified | 25-Jul-2017 00:00:00 |
| Symptom | 303000 Steering/Handling |
| Content | <p>Issue: Vehicle user reports a click noise from the front of the vehicle when turning the steering wheel (with the wheels on the ground). Noise is audible outside and inside the vehicle.</p> <p>Cause: Hub/Knuckle joint not fully consolidated</p> <p>Action:</p> <ol style="list-style-type: none">1. Tighten existing hub nut to 170Nm2. Remove old hub nut and discard - DO NOT USE Air or Electric tools - remove by hand and use hand tools.3. Fit new hub nut - DO NOT USE Air or Electric tools.4. Apply 80Nm Torque.5. Apply 60° Angle. <p>Technicians - Please rate this SSM and provide comments so that future communications can be improved.</p> <p>1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.</p> <p>3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.</p> <p>5 = Excellent – All required information provided to resolve the customer concern.</p> |