



SERVICE BULLETIN

Classification: AT17-006	Reference: NTB17-073	Date: July 6, 2017
-----------------------------	-------------------------	-----------------------

2017 ROGUE; PARK LIGHT ON SHIFT ASSEMBLY REMAINS ON LONGER THAN 5 MINUTES AFTER SHIFTED TO PARK

APPLIED VEHICLE: 2017 Rogue (T32) **Without Intelligent Key**

APPLIED VIN Built on or between:
2WD - JN8AT2M(*)HW 130101 and JN8AT2M(*)HW 152254
AWD - JN8AT2M(*)HW 000101 and JN8AT2M(*)HW 026247
AWD - JN8AT2M(*)HW 250001 and JN8AT2M(*)HW 269072

APPLIED DATE: Built on or before April 7, 2017

IF YOU CONFIRM

After the vehicle has been shifted into Park (P), the ignition switch is OFF and the doors are closed:

- P indicator light (Figure 1) on the shift assembly does not go OFF after 5 minutes.

And

- Applied VIN begins with "JN8".



Figure 1

ACTION

- Adjust the key interlock cable.

NOTE: Nissan vehicle warranty does not cover incidents due to lack of vehicle maintenance and/or physical damage. Refer to New Vehicle Limited Warranty in the Nissan Assurance Products Resource Manual (APRM) for warranty coverage guidelines and complete information regarding warranty coverage.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

Key Interlock Cable Adjustment

1. Remove the center console finisher to gain access to the key interlock cable adjuster shown in Figure 2.
 - Refer to the Electronic Service Manual (ESM), section **IP – Instrument Panel**, for removal and installation.

IMPORTANT: If the ignition is ON or turned ON when the passenger air bag indicator lamp is disconnected, supplemental restraint system (SRS) related DTCs may set and be permanently stored in the air bag diagnosis sensor unit.

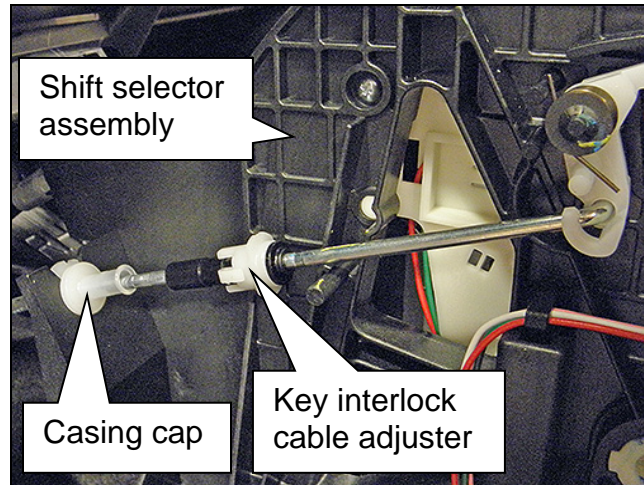


Figure 2

2. Unlock key interlock cable adjuster (Figure 3 and Figure 4):
 - a. Press the pawls (B) of the key interlock cable slider (A),
 - b. while sliding it in the direction of the casing cap (C),
 - c. and then separate the adjust holder (D) and slider.

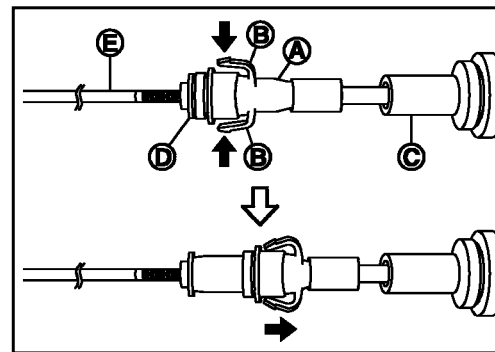


Figure 3

3. Adjust key interlock cable (Figure 4):
 - a. Shift to "P" position (if not already).
 - b. Turn the ignition switch to LOCK position.

NOTE:

- Do not bend or twist the cable forcefully.
- Confirm that the casing cap is fastened to the cable bracket (Figure 2).

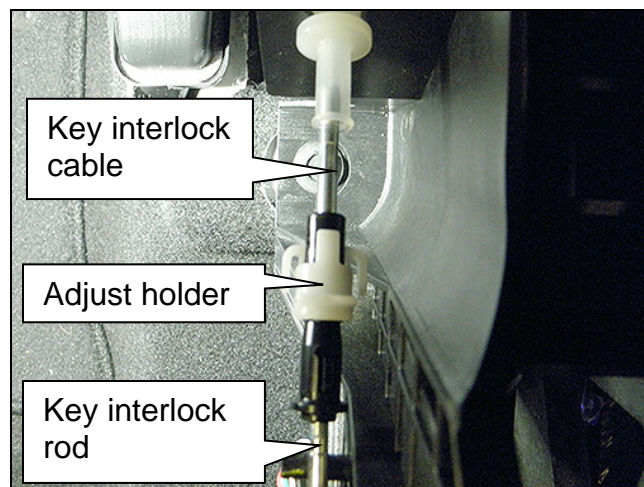


Figure 4

- c. Pull the adjust holder onto the key interlock rod until movement stops and adjust holder cannot be pulled any further; all free-play has been removed.

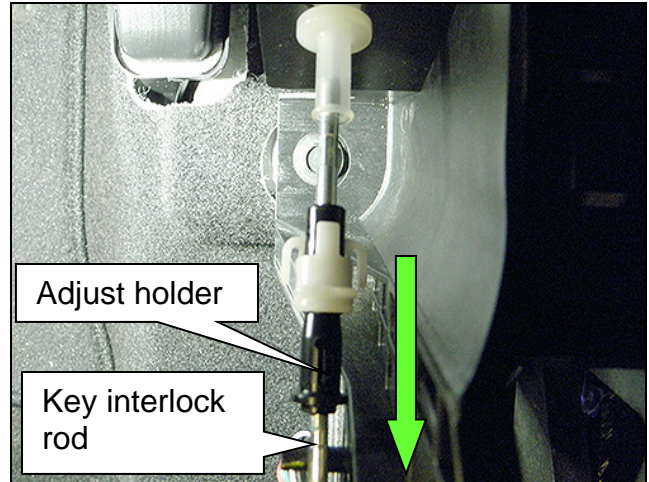


Figure 5

- d. While holding the adjust holder in position from step "c", Move the key interlock cable slider towards the key interlock rod side and lock it (over the adjust holder).

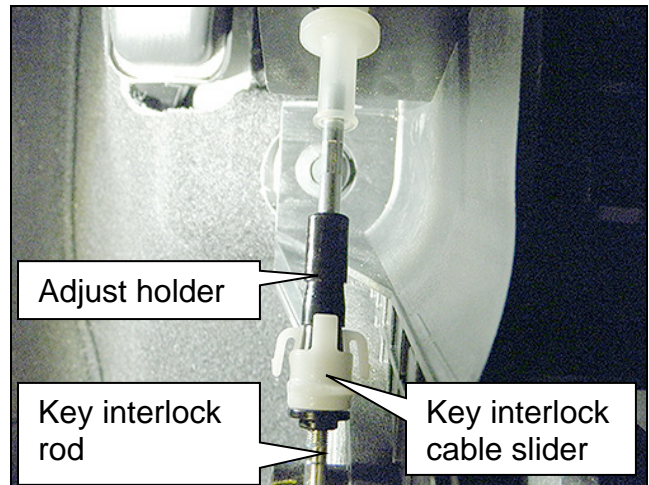


Figure 6

- 4. Proceed to **Inspection after Adjustments** on next page.

Inspection after Adjustments

5. After performing key interlock cable adjustment confirm the following items:
 - a) "Control Device"
 - i) To operate the "control lever" from "P" position to other ranges under ignition ON state, the lever is not operable unless the brake pedal is stepped on.
 - ii) In other ranges, it is operable regardless of the brake pedal. At "P" position, the "control lever" is not operable under any state other than ignition ON.
 - b) "Steering Lock"
 - i) The key can be removed only when the "control lever" is in the "P" position.
6. Turn the ignition OFF, and then disconnect the passenger air bag indicator lamp.

IMPORTANT: If the ignition is ON or turned ON when the passenger air bag indicator lamp is disconnected, supplemental restraint system (SRS) related DTCs may set and be permanently stored in the air bag diagnosis sensor unit.
7. Reassemble the vehicle in reverse order of disassembly.
8. After turning the ignition ON or starting the engine, make sure the supplemental air bag lights turn OFF after approximately seven (7) seconds.
9. Use CONSULT-III plus to erase any DTCs caused by this repair.

CLAIMS INFORMATION

Submit a Primary Operation (PO) type line claim using the following claims coding:

MODEL	DESCRIPTION	OP CODE	SYM	DIA	FRT
Rogue	Adjust Key Interlock Cable	JX51AA	ZE	32	0.5