



SERVICE BULLETIN

Classification: EL17-017	Reference: NTB17-078	Date: July 13, 2017
-----------------------------	-------------------------	------------------------

2009 – 2017 370Z COUPE; DOOR WINDOW DOES NOT LOWER SLIGHTLY WHEN DOOR IS OPENED

APPLIED VEHICLES: 2009 – 2017 370Z Coupe (A34)

NOTE: Does not apply to 370Z Roadster (Convertible)

IF YOU CONFIRM

The door window does not lower slightly when the door is opened, or the customer reports this issue.

NOTE: Normal operation:

- When the door is being opened, the window is automatically lowered slightly to avoid contact between the window and the side roof panel.
- When the door is closed, the window is automatically raised slightly.

ACTIONS

Replace the BCM with the one listed in the Parts Information.

- Refer to the Electronic Service Manual (ECM), section BCS-Body Control Systems, for BCM replacement information.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Body Control Module (BCM)	284B1 – 6GE0A	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace BCM	284B1 – 6GE0A	RD94AA	ZE	32	(1)

(1) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.