

Additional Coolant Pump Fault (POC4700) Causes MIL

Attention: **Service Personnel**

Vehicle Type: **Cayenne PHEV (92A)**

Model Year: **2015 - 2017**

Customer Concern: The customer observes a Malfunction Indicator Lamp (MIL). (Note: Typically, this MIL is the only symptom of this issue.)

Technical Concern: The technician confirms the MIL and notes POC4700 is present in the high-voltage battery.

Service Information: In many cases, technicians noted one or more of the following root causes:
a) Corrosion on Ground Pin 6B (See figures 1 and 2.)
b) Corrosion on the connector to the secondary low temperature coolant pump.
c) A bad ground or otherwise unsound wiring.

The service recommendation is to check the ground, connector, and wiring for corrosion and circuit continuity. Repair the ground, connector, or wiring as needed. Sometimes, the ground bolt is painted and not adequately conductive. In this case, clean the ground bolt and eyelet using a wire brush and sandpaper.

If the ground, connector, and wiring are acceptable, replace the electric water pump and the electric water pump relay.

As always, be sure to document the repair completely in PQIS.

For this repair, please code the "cause" as follows:

Cause location: 19450 Additional coolant pump
Cause symptom: 1611 No function

Service Information:
(cont'd)

Looking into right front wheel well through the headlamp area (Driver side similar)

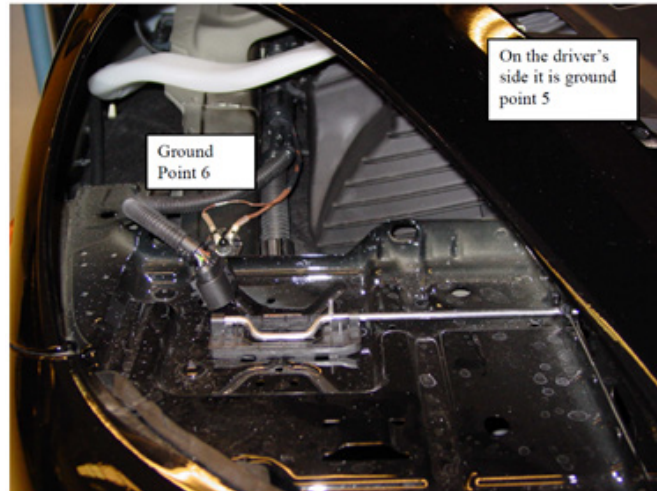


Figure 1 – Ground Pin 6B



Figure 2 – Example of corrosion on ground point

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macan®, Panamera®, Speedster®, Spyder®, Tiptronic®, VarioCam®, PCM®, PDK®, 911®, RS®, 4S®, 718®, 918 Spyder®, FOUR UNCOMPROMISED®, and the model numbers and distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. However, specifications, standard equipment and options are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. Please ask your authorized Porsche dealer for advice concerning the current availability of options and verify the optional equipment that you ordered. Porsche recommends seat belt usage and observance of traffic laws at all times.