



# Technical Service Bulletin

---

## 01 MIL on (DTC P026100 or P006800 or P227900 in ECM) - 2.0 TFSI

01 17 96 2045222/2 January 18, 2017. Supersedes Technical Service Bulletin Group 01 number 16-76 dated September 22, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2016 - 2017	All	Not Applicable

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (Added customer codes)
1	09/22/2016	Initial publication

The customer's concern states that a MIL light has appeared:

- Exhaust emissions warning lamp on

At least one of the following DTC's is stored in the engine control module:

- **DTC P006800** (intake manifold pressure/air mass quantity <-> throttle valve angle deviation)

Or

- **DTC P227900** (air leaks in intake system)

Or

- **DTC P26100** (counter for parking time, malfunction)

## Technical Background

OBID diagnostics too sensitive.



# Technical Service Bulletin

---

## Production Solution

New software in the Engine Control Module (J623) (address word 0001) addressed the condition.

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the engine control unit (J623) (address word 0001) using the SVM action code as listed in the table below if necessary:

Model	Engine	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A4 (B9)	CYMC	8W0906259C	0001-0004	8W0906259C	0005	01A221

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	2470		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Update ECM via SVM	2470 9999	50 TU
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion		



# Technical Service Bulletin

---

	(Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)
<b>Claim Comment:</b>	As per TSB # 2045222/2

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All parts and service references provided in this TSB (2045222) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.