



Technical Service Bulletin

57 Anti-theft alarm goes off without cause

57 17 35 2045051/3 January 13, 2017. Supersedes Technical Service Bulletin Group 57 number 16-33 dated December 14, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2016 - 2017	All	Not Applicable
Q7	2016 - 2017	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>Service</i> (Updated SVM table) Revised header data (Added model years)
2	12/14/2016	Revised <i>Service</i> (SVM Code)
1	08/15/2016	Initial publication

- The anti-theft alarm goes off without a cause.
- **DTC B131DF6** (Sirens/alarm horn for anti-theft warning system wrong code) is stored in the comfort system central control module, J393 (address word 0046).

Technical Background

The software of the comfort system central control module, J393 (address word 0046) needs to be updated. The updated software will resolve the false alarm.

Production Solution

Optimized software.



Technical Service Bulletin

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the comfort system central control module, J393 (address word 0046), using the SVM action code as listed in the table below, if necessary:
 - On the ODIS tester, enter the SVM code in operation mode “update”.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A4/Q7	8W0907064* or 4M0907064*	<0344	8W0907064* or 4M0907064*	0344	46A017

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	5789		
Damage Code:	0039		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 70 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU



Technical Service Bulletin

	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)
Claim Comment:	As per TSB #2045051/3

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2045051) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.