

Reference	SSM73549
Models	F-PACE / X761 F-TYPE / X152 XE / X760 XF / X260 XJ / X351
Title	Side object detection modules false flagging DTC U3000-49
Category	Electrical
Last modified	08-Sep-2017 00:00:00
Symptom	206000 Warning Indicators

Content**Issue**

At PDI or at normal service, the dealer may find **DTC - U3000 - 49 Control Module internal electronic failure** – recorded in the **Side Object Detection Left (SODL)** or **Side Object Detection Right(SODR)** without any customer impact on the Blind Spot Monitor features.

Cause

False flagging DTC due to Software issue.

Action

Please **DO NOT** replace the SODL/SODR module if this DTC **U3000 – 49** is flagged. If there is no customer complaint (Blind Spot features working as intended) clear the DTC and take no further action.

If the customer reports "Blind Spot Monitor Not Available" message on the instrument cluster then re-flash BOTH SODL and SODR modules to the latest software available.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.

