

SSM 46802	Some 2016 - 2017 Expedition/Navigator vehicles may exhibit a no start condition with DTC P025A being stored. This may be due to a pin push-out condition at pin 14 of connector C139, circuit CE608 (VT/GN), on either the 14405 or 12A581 harness side of the connector. Inspect Pin 14 for proper retention and repair the harness as needed. For claiming, use causal part 14405 or 12A581 as appropriate, and applicable labor operations in section 10 of the service labor time standards (SLTS) manual.
--------------	--