

## Window lifter reverses direction

---

|                   |                                |
|-------------------|--------------------------------|
| Topic number      | LI72.40-P-065833               |
| Version           | 2                              |
| Design group      | 72.40 Door control             |
| Date              | 05-19-2017                     |
| Validity          | MODEL 205.0 /205.1 /205.2 /253 |
| Reason for change | Remedy adjusted                |
| Reason for block  |                                |

---

### Complaint:

Window lifter reverses direction on reaching upper end position.

In Xentry Diagnostics (XD) the power window system is shown as "normalized".

### Path in XD:

XD => Control units view => DCU-xx => Actual values => Power windows => Normalization of power window

### Cause:

Software adjustment in door control unit (DCU-xx).

### Remedy:

Perform commissioning of affected door control unit (DCU/xx).

The power window system must then undergo a teach-in procedure whereby the side window pane must be fully opened and closed at least two times "manually" (push power window switch to 1st notch only).

Note: Replacement of parts does not remedy the complaint

| Symptoms                                                                        |
|---------------------------------------------------------------------------------|
| Body / Glazing / Window lifting mechanism/window operation / Remains stationary |
| Body / Glazing / Window lifting mechanism/window operation / Does not run up    |
| Body / Glazing / Window lifting mechanism/window operation / Stiff/sluggish     |
| Body / Glazing / Window lifting mechanism/window operation / Opens by itself    |

| Control unit/fault code                               |            |            |
|-------------------------------------------------------|------------|------------|
| Control unit                                          | Fault code | Fault text |
| N69/1 - Left front door (DCU-LF) (DMFL222) (C (205))  | -          | -          |
| N69/2 - Right front door (DCU-RF) (DMFR222) (C (205)) | -          | -          |

# XENTRY TIPS

---

|                                                      |   |   |
|------------------------------------------------------|---|---|
| N69/3 - Left rear door (DCU-LR) (DMRL222) (C (205))  | - | - |
| N69/4 - Right rear door (DCU-RR) (DMRR222) (C (205)) | - | - |

| Operation numbers/damage codes |                |      |             |      |
|--------------------------------|----------------|------|-------------|------|
| Op. no.                        | Operation text | Time | Damage code | Note |
|                                |                |      | 72220 GR    |      |
|                                |                |      | 72230 GR    |      |
|                                |                |      | 73A30 GR    |      |
|                                |                |      | 73N30 GR    |      |