

Message in instrument cluster "Collision Prevention Assist Inoperative"

Topic number	LI54.70-P-065987
Version	3
Design group	54.70 Proximity warning system
Date	05-22-2017
Validity	BR 117/156/176/246 with code 258 BR 205/253 with code 258 BR 166/292 with code 258
Reason for change	Remedy added. Validity adapted.
Reason for block	

Complaint:

After engine start the following message appears in the instrument cluster:

- "Collision Prevention Assist Inoperative".

Note:

The following code (DTC) is logged in the CPA control unit (A90):

- B220600.

Cause:

The monitoring of the CAN message transmitted by the EZS is too sensitive with regard to the vehicle VIN in the CPA control unit.

Remedy:

Software update.

To do this, follow the modified guided test for DTC B220600 in XENTRY.

Note:

For this, the following addon must be installed:

- Addon no. 7470 for XENTRY DVD 05/2017.

Symptoms
Communication/information / Warning and control system / COLLISION PREVENTION ASSIST / Warning message in instrument cluster
Communication/information / Warning and control system / COLLISION PREVENTION ASSIST / Warning system nonfunctional

XENTRY TIPS

Control unit/fault code		
Control unit	Fault code	Fault text
A90 - Control unit 'COLLISION PREVENTION ASSIST' (SG-AWF) (FCW222) (C (205))	B220600	The current vehicle identification number is incorrect or not present. _

Validity		
Vehicle	Engine	Transmission
A (176)	*	*
B (242, 246)	*	*
C (205)	*	*
CLA (117)	*	*
GL/GLS (166)	*	*
GLA (156)	*	*
GLC (253)	*	*
GLE (292)	*	*
M/GLE (166)	*	*