



Repair Notice

617-1

Section

Engine

Description

PX-9 engines may develop a leak from return fuel fitting

Release Date

6/7/2017

Introduction

Peterbilt has identified certain Model 567 vehicles built between 01/10/2017 and 02/08/2017 with PX-9 engines that may develop a leak at the return fuel tee fitting o-ring.

See chassis list below

Resolution

CAMPAIGN

Service all chassis affected that enter your dealership, even if the customer has no issue with the chassis. Review the attached chassis list for your dealer code and schedule your customer(s) for service if their chassis is on the list. Review the DWWC or SIR for "Complete" next to the "617-1" campaign code prior to performing this repair.

Warranty

Through Standard Warranty or for repairs completed by **06/01/2018**, whichever is greater, Peterbilt will pay for parts at dealer net plus applicable mark-up and labor:

- 0.3 hours labor to R&R the return fuel fitting. Use Quick claim 617-1
- File an additional claim for extraordinary circumstances.

NOTE: Peterbilt dealers may perform 617-1 repairs on Kenworth chassis, but Quick Claims do not apply. For Kenworth chassis repairs, use the long claim input form in DWWC selecting "Draft/Offline Claims," the "General" tab, and in the "Type of Claim" drop down box, select "PACCAR Engine Claim," then manually enter claim codes (Campaign #, Failure type, and SRT).

For Field...	Enter...
Failure Location	044-001-012
Failure Type	700
Claim Type	A
Responsibility	09
SRT 044-???	0.30 hours labor to R&R the return fuel fitting.

Take-Off Parts Disposition: Destroy take-off parts 30 days after claim is paid.


Parts

Parts are available from PACCAR Parts.


Quantity	Part Number	Description
1	V38-1309	Return Fuel Fitting

Procedure

1. Remove the return line from the fitting

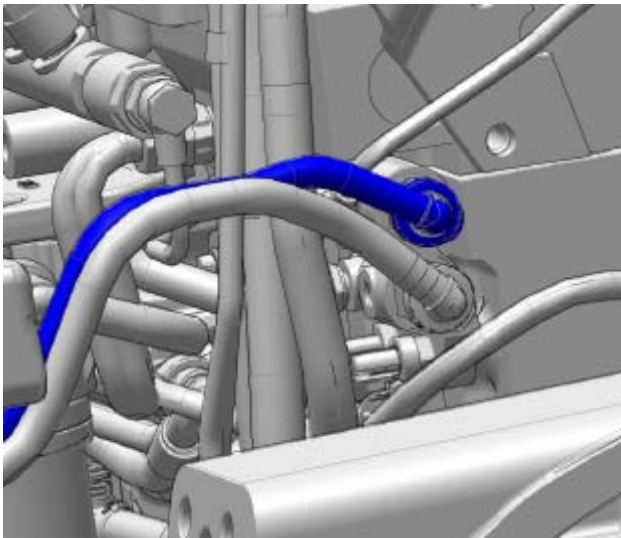

2. Remove the return fitting from the engine.

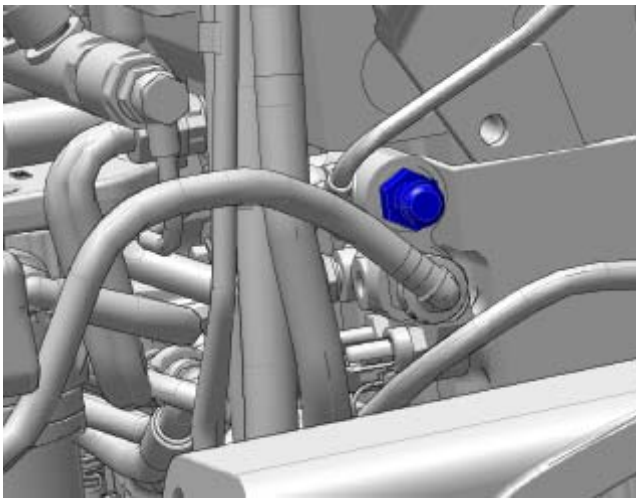

3. Install the new return fitting and torque it to 95 N·m (70 lb-ft).
4. Connect the return line to the fitting.

Attachments

[617-1 Chassis List](#)

[617-1 Customer Letter](#)

Access to PACCAR's Enterprise Portal is provided as a benefit of doing business with PACCAR. All applications and content accessed through this system are confidential and proprietary and the property of PACCAR Inc and its suppliers, and must be kept strictly confidential pursuant to the contract licensing such access. Disclosure, publication, release or distribution of any material found on PACCAR systems to any person other than employees with a need to know such information is strictly prohibited. All activity on this system is monitored. If PACCAR suspects or discovers any unauthorized activity, access may

be immediately terminated without prior notification. Violators may be subject to legal action.

© Copyright 2017 PACCAR Inc. All rights reserved. We welcome your [feedback](#) on this page. For technical questions or concerns about this page, please contact the [DealerNet Webmaster](#).

Date TBD

[First VIN]

Customer Name

Address

City, State Zip

Subject: 617-1 – PX-9 Return Fuel Fitting

Dear Peterbilt Customer,

Your vehicle (listed within this letter) is eligible for a campaign to replace the return fuel fitting. The fitting may have been manufactured with an enlarged sealing area which could lead to a potential fuel leak.

<i>The problem is...</i>	PX-9 Return fuel fitting may leak
<i>What your dealer will do...</i>	Remove and replace the defective fuel fitting
<i>What you must do ...</i>	Contact your Peterbilt Dealer to schedule an appointment for repair

Please contact a Peterbilt dealership to schedule an appointment for this work. If you have already had this work performed, please disregard this letter. You can find your nearest Peterbilt dealer at Dealer Locator on the website www.Peterbilt.com.


When contacting your selected Peterbilt dealer, refer to campaign 617-1 and the VIN listed on this letter. The work will take approximately 1.0 hour, depending on vehicle configuration and dealer scheduling. There will be no charge to you if completed within Standard Warranty or for upgrades completed by 06/01/2018, whichever is greater.

If you require further information about this recall, reimbursement of a pre-notification remedy associated with this recall or experience any difficulty in making arrangements for this repair, please contact: Peterbilt Motors Company, 1700 Woodbrook St. Denton, TX 76205, Attn: Quality Services Department, phone 940-591-4220.

We apologize for any inconvenience this preventive procedure may cause and thank you for your participation in helping Peterbilt provide the highest levels of customer satisfaction and service expertise.

We value your business and appreciate your ongoing loyalty to Peterbilt and its dealer network. Industry-leading quality, performance and reliability are hallmarks of Peterbilt products, and we thank you for making Peterbilt your truck of choice.

Thank you,

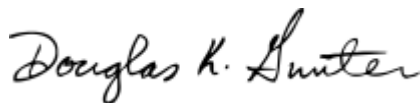

Doug Gunter
Director of Warranty
Peterbilt Motors Company