

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: 06-001/17 - LEATHER STEERING WHEEL SURFACE WEAR / PEEL	Bulletin No.: 06-001/17
	Last Issued: 06/02/2017

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below: The changes are noted in Red.

Previous TSBs:	Date(s) Issued:
06-001/17	04/25/2017

APPLICABLE MODEL(S)/VINS

2014-2016 Mazda3 Japan built vehicles with VINs lower than JM1 BM ***** 355940 (produced before June 23, 2016)

2014-2016 Mazda6 vehicles with VINs lower than JM1 GJ ***** 488592 (produced before June 30, 2016)

2016-2017 CX-3 vehicles with VINs lower than JM1 DK ***** 172170 (produced before March 08, 2017)

2016-2017 CX-5 vehicles with VINs lower than JM3 KE ***** 921726 (produced before December 21, 2016)

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

DESCRIPTION

Some vehicles may exhibit wear/peel-off of the leather steering wheel surface causing a poor appearance. This concern may be caused by an insufficient wear resistance of the steering wheel surface.

Mazda6 is shown as an example




Customers having this concern should have their vehicle repaired using the following repair procedure.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

REPAIR PROCEDURE

Note: Some vehicles may have steering wheel stains caused by chemicals such as hand lotions.

1. Use a clean towel dampened in leather/vinyl cleaner or mild soap to clean the steering wheel.

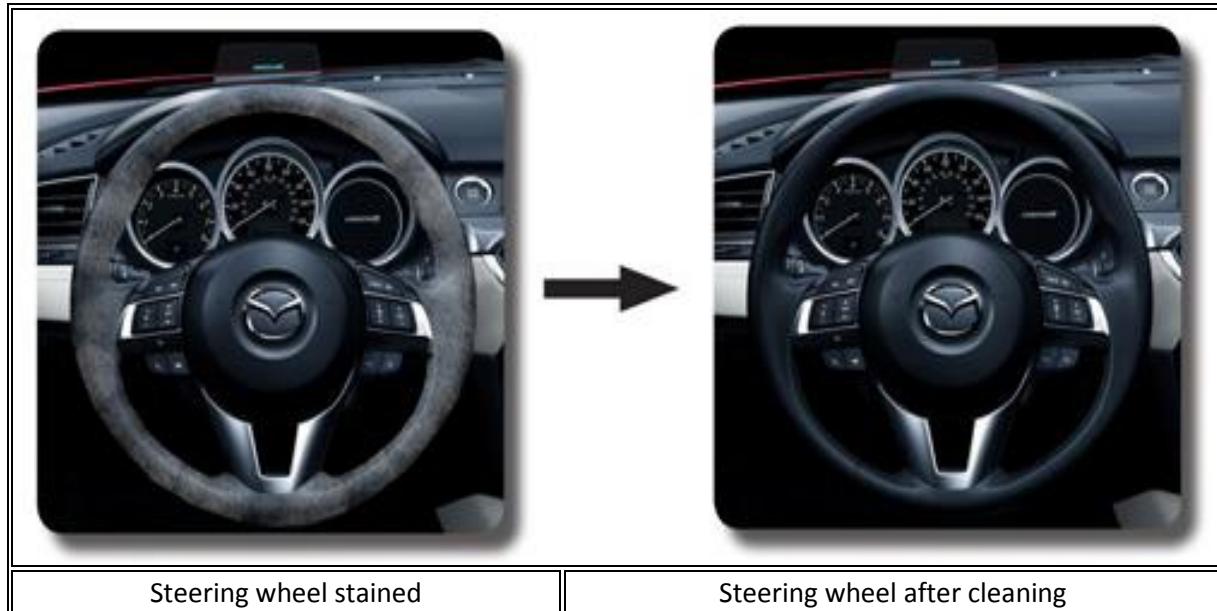


2. Is the steering wheel wear/peel concern present after cleaning the steering wheel?

- Yes - Go to Step 3.
- No - This service bulletin does not apply.

3. Replace the steering wheel (A). Refer to MGSS online Workshop Manual:

- Mazda3 - STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION.
- Mazda6 - STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION.
- CX-3 - STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION.
- CX5 - STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

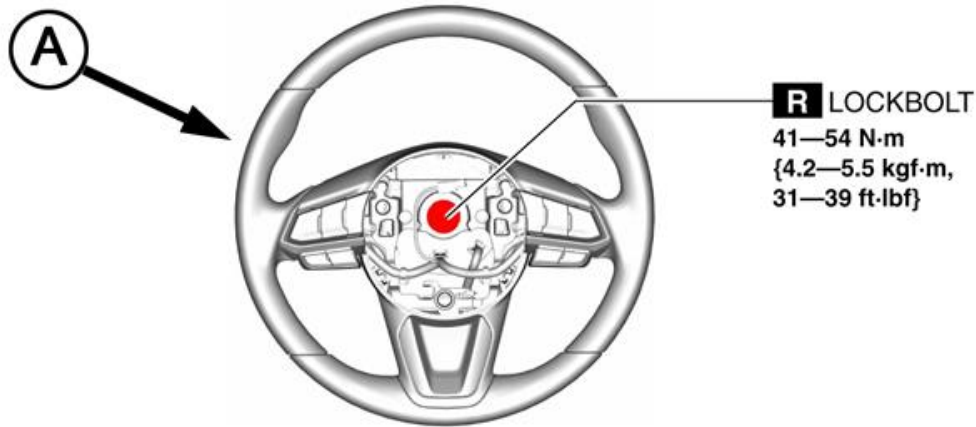

4. Verify repair.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
KD46-32-982C02 or KDY6-32-982	STEERING WHEEL	1	CX-3 (Leather, black stitch) CX-5 (Leather, black stitch)
KA0G-32-982 02	STEERING WHEEL	1	CX-5 (Smooth leather, black stitch)
BHP2-32-982B02 or BHY2-32-982	STEERING WHEEL	1	Mazda3 (Leather, black stitch)
GHR1-32-982B or GHY1-32-982	STEERING WHEEL	1	Mazda6
9YA0-11-003A	BOLT	1	CX-3, CX-5
9YA0-11-007	BOLT	1	Mazda3, Mazda6

Note:

- Use GEPC to look up correct part number by VIN.
- **If steering wheel part with the "Y" in the 3rd digit is in your dealer's inventory, you may use it for this repair.**
- **Both steering wheel part numbers with or without the "Y" in the 3rd digit provide the same repair performance.**

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	45
Damage Code	9C
Part Number Main Cause	GHR1-32-982B or GHY1-32-982, Steering Wheel (Mazda6)

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

	BHP2-32-982B02 or BHY2-32-982, Steering Wheel (Mazda3) KD46-32-982C02 or KDY6-32-982, Steering Wheel (CX-3, CX-5) KA0G-32-982 02, Steering Wheel (CX-5)
Quantity	1
Operation Number / Labor Hours:	XXMA6XRX / 0.4 Hrs.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.