Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:

09-016/17 - SEAT WARMER MALFUNCTION (CLOTH SEATS ONLY)

Bulletin No.: 09-016/17

Last Issued: 06/28/2017

BULLETIN NOTES

Previous TSBs:	Date(s) Issued:
09-016/17	04/27/17


For vehicles equipped with leather seats, go to TSB 09-015/17.

APPLICABLE MODEL(S)/VINS

2013-2016 CX-5 vehicles equipped with cloth seats.

DESCRIPTION

Some vehicles may exhibit the driver and/or front passenger side seat warmer(s) malfunction on any mode (High, Mid and Low). This may be caused by repeated load applied to the seat cushion (A) while the seat is occupied. A section of the heater mat (B) just above the reinforcement rod (C) in the cushion pad (A) contacts internal heater mat wire and causes damage (D).

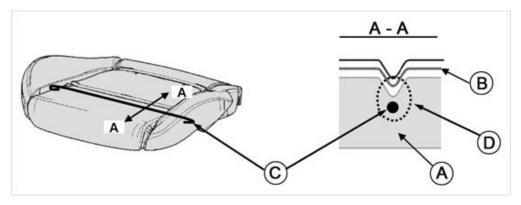

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

- 1. Verify the seat warmer is inoperative.
- 2. Replace the seat cushion pad(s). Refer to the MGSS online instructionsFRONT SEAT CUSHION TRIM REMOVAL/INSTALLATION.

Page 1 of 6

Bulletin No.: 09-016/17	Last Issued: 06/28/2017	

NOTE: A new seat cushion pad is available with repositioned internal heater mat wire to prevent contact with reinforcement rod.

3. Verify repair.

Page **2** of **6**

Bulletin No.: 09-016/17	Last Issued: 06/28/2017	

PARTS INFORMATION

Page 3 of 6

Bulletin No.: 09-016/17 **Last Issued:** 06/28/2017

Parts Number	Description	Qty.	Notes	Image
KEY0-88-11X	HEATER PAD (R), CUSHION	1		
	HEATER PAD (L), CUSHION		Charle Coast	
KDY9-88-16X	(Fits: 2013-2015 CX- 5)	1	Cloth Seat Cushion	
KAYK-88-16X	HEATER PAD (L), CUSHION (Fits: 2016 CX-5)	1		
KD35-88-1H5 02	RECLINER KNOB (L)	1	Non-reusable part	L 1/
KD45-88-1G5 02	RECLINER KNOB (R)	1	Non-reusable part	R
KD45-88-857 02	LIFTER KNOB (L)	1	Non-reusable part	R
KD45-88-585	CLIP	2 or 4	Non-reusable part	

NOTE:

Page **4** of **6**

- Use GEPC with VIN to look up the correct part number(s).
- For vehicles equipped with leather seats, go to TSB 09-015/17.

Page **5** of **6**

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А
Symptom Code	61
Damage Code	9R
Part Number Main Cause	**** 8816X*/**** 88 11X* (Enter the part number of HEATERPAD, CUSHION applicable to the subject vehicle)
Quantity	1
Operation Number / Labor Hours:	XX MC7ARX, 0.9 Hrs. (Driver side) XX MC7BRX, 1.1 Hrs. (Passenger side) XX MC7CRX, 1.8 Hrs. (Both sides)

Page **6** of **6**