

Product Upgrade Bulletin 170615REV



UPGRADE BULLETIN:
170615REV

YEAR(S) AFFECTED:
2017

PRODUCT(S) AFFECTED:
Fleetwood Storm
Holiday Rambler
Vacationer XE

MODEL(S) AFFECTED:
32A, 34 S
manufactured
May 17, 2016
through
March 24, 2017

SUBJECT:
Installing
attachment
brackets for sofa
overhead cabinet

KEYWORDS:
cabinet, overhead

ISSUE DATE:
June 2017

The purpose of this Product Upgrade bulletin is to inform REV dealers of the procedure for installing additional means of securing the overhead sofa cabinet to the slide-out ceiling in certain model year 2017 Fleetwood Storm and Holiday Rambler Vacationer XE, Models 32A and 34S. A list of affected vehicles appears at the end of this Bulletin.

CONDITION:

On motorhomes affected by this Product Upgrade, the fasteners for the sofa overhead cabinet may be inadequately secured by the existing fasteners, and may come loose over time.

CORRECTION:

Follow the steps below to install cabinet attachment brackets to the sofa overhead cabinet and ceiling.

Read entire procedure before proceeding with any work.

1. Park the motorhome on dry, level pavement with adequate clearance to extend the living room slide-out. Place the transmission in Park and set the parking brake. Chock the wheels to prevent movement.
2. Level the unit using the leveler touchpad.
3. With the engine running, extend the living room slideout.
4. Open the sofa overhead cabinet doors to gain access to the horizontal pine cleat that secures the cabinet face to the ceiling. See Figures 1 & 2.
5. Position a bracket against the horizontal pine cleat and the ceiling. Using the holes in the bracket as a guide, mark the locations for two holes in the pine cleat. See Figure 3.



Figure 1



Figure 2

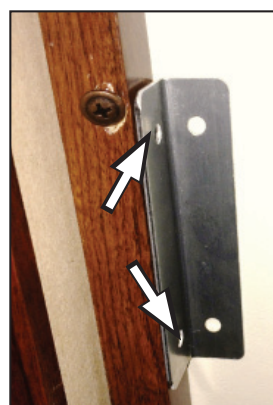


Figure 3

© 2017 REV Recreation Group Inc.

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

6. Carefully pre-drill 1/16" x 3/4" deep pilot holes in the cleat. Use new #6 x 5/8" sheetmetal screws to secure the angle bracket to the pine cleat.

7. Push up on the cabinet to ensure the cabinet face is tight along the ceiling.

Using the bracket holes as a guide, carefully drill two, 7/32" dia. x 1" deep holes into the ceiling. See Figure 4. Rivet the bracket to the ceiling using the holes.

NOTE: When drilling holes use care to avoid drilling through the cabinet face or slide ceiling. Hole depth of 3/4" to 1" is sufficient.

8. Repeat Steps 5-7 for each sofa overhead cabinet door.



Figure 4

PARTS:

Part Number	Description	Qty.
10000925	Brackets	3
10110066	Rivet, 3/16" X 3/8" Lo-Prohead	6
10007530	#6 x 5/8" PPH Screw	6

TOOLS

- Drill/Driver
- 7/32" drill bit
- 1/16" drill bit
- Phillips driver bit
- Pop rivet gun

WARRANTY LABOR ALLOWANCE:

Product Upgrade 170615REV - Securing Sofa Overhead Cabinet

Use Flat Rate Code:	Time
6060-12 Product Upgrade 170615REV Inspected/Repaired	.5 hour

If you have any questions regarding this Bulletin, contact
REV Dealer Technical Support:

Monaco/Holiday Rambler Dealer Technical Support:
(877) 332-9239

Fleetwood Dealer Technical Support:
(800) 816-9825

Service literature can be accessed online at: <http://revrvdealers.com>

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Product Upgrade Bulletin 170615REV - Affected Unit Serial Numbers

2017 Fleetwood Storm, Models 32A and 34S

REV Unit Serial #	Chassis/VIN
785AH4423305	1F66F5DYXG0A10912
785AH4423890	1F66F5DY5G0A14768
785AH4423951	1F66F5DY3G0A15532
785SH4423958	1F66F5DY5H0A00113
785AH4424009	1F66F5DY8G0A15526
785AH4424079	1F66F5DY9G0A15535
785AH4424088	1F66F5DY1G0A15531
785AH4424097	1F66F5DYXG0A15527
785AH4424106	1F66F5DY0G0A15522
785AH4424126	1F66F5DY4H0A00863
785AH4424134	1F66F5DY1H0A00092
785AH4424182	1F66F5DY0H0A00097
785AH4424188	1F66F5DY3H0A00093
785AH4424193	1F66F5DY7G0A14237
785AH4424204	1F66F5DY7H0A00856
785AH4424223	1F66F5DY0H0A00858
785AH4424226	1F66F5DY9H0A00860
785AH4424230	1F66F5DY6H0A01691
785AH4424235	1F66F5DY7H0A01697
785AH4424287	1F66F5DY7H0A00095
785AH4424290	1F66F5DY3H0A01339
785AH4424295	1F66F5DY0H0A01346
785AH4424302	1F66F5DY4G0A14762
785AH4424310	1F66F5DY8G0A14764
785AH4424357	1F66F5DY3G0A14235
785AH4424360	1F66F5DY5G0A14236
785AH4424365	1F66F5DYXG0A14765
785AH4424368	1F66F5DY9H0A00857
785AH4424373	1F66F5DY6H0A00864
785AH4424381	1F66F5DYXH0A00866
785AH4424427	1F66F5DY2H0A01347
785AH4424430	1F66F5DY1H0A01341
785SH4424435	1F66F5DY8H0A01367
785AH4424438	1F66F5DY4H0A01348
785AH4424451	1F66F5DYXH0A01693

REV Unit Serial #	Chassis/VIN
785AH4424478	1F66F5DY5H0A01696
785SH4424480	1F66F5DYXH0A01368
785AH4424483	1F66F5DY8H0A01692
785SH4424491	1F66F5DY9H0A02494
785AH4424496	1F66F5DY5H0A00855
785SH4424546	1F66F5DY7H0A02493
785SH4424548	1F66F5DY4H0A02161
785SH4424556	1F66F5DY6H0A02162
785SH4424560	1F66F5DY6H0A02811
785SH4424563	1F66F5DY8H0A02163
785SH4424567	1F66F5DY8H0A02812
785SH4424570	1F66F5DY1H0A02814
785SH4424616	1F66F5DY1H0A01369
785SH4424626	1F66F5DY1H0A02165
785SH4424630	1F66F5DY3H0A02166
785SH4424687	1F66F5DY6H0A03635
785AH4424693	1F66F5DY2H0A00862
785SH4424711	1F66F5DY7H0A02168
785SH4424755	1F66F5DY6H0A03988
785SH4424763	1F66F5DYXH0A03637
785SH4424771	1F66F5DYXH0A03993
785SH4424892	1F66F5DY5H0A03139
785AH4424897	1F66F5DY6G0A14763
785SH4424916	1F66F5DY3H0A04628
785AH4424967	1F66F5DY1H0A01694
785SH4425008	1F66F5DY3H0A04483
785SH4425016	1F66F5DY7H0A05118
785AH4425021	1F66F5DY9H0A01345
785SH4425059	1F66F5DY1H0A05809
785SH4425065	1F66F5DY4H0A05593
785AH4425068	1F66F5DY2H0A00456
785SH4425070	1F66F5DY2H0A05589
785AH4425072	1F66F5DY6H0A05577
785AH4425078	1F66F5DY8H0A05578
785AH4425085	1F66F5DY1G0A15528

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Product Upgrade Bulletin 170615REV - Affected Unit Serial Numbers

2017 Fleetwood Storm, Models 32A and 34S

REV Unit Serial #	Chassis/VIN
785AH4425135	1F66F5DY6H0A00458
785SH4425138	1F66F5DY1H0A03994
785SH4425142	1F66F5DY9H0A05587
785SH4425145	1F66F5DY7H0A05586
785SH4425204	1F66F5DY3H0A04631
785SH4425210	1F66F5DY2H0A05592
785SH4425214	1F66F5DYXH0A05114
785AH4425218	1F66F5DY1H0A03977
785AH4425220	1F66F5DY8H0A00459
785AH4425276	1F66F5DY3H0A07030
785AH4425346	1F66F5DY5H0A06655
785AH4425350	1F66F5DY7H0A07029
785AH4425357	1F66F5DY5H0A07031
785SH4425402	1F66F5DY6H0A06664
785AH4425420	1F66F5DY7H0A06656
785SH4425471	1F66F5DY8H0A06326
785AH4425482	1F66F5DY7H0A07984
785AH4425539	1F66F5DY6H0A08348
785SH4425546	1F66F5DY6H0A07040
785SH4425588	1F66F5DY2H0A07035
785SH4425596	1F66F5DY9H0A04486
785AH4425766	1F66F5DY3H0A08792
785SH4425817	1F66F5DY9H0A07033
785AH4425823	1F66F5DY9H0A09140
785AH4425827	1F66F5DYXH0A09485
785AH4425835	1F66F5DY5H0A09751
785AH4425845	1F66F5DY5H0A09765
785AH4425849	1F66F5DY3H0A09750
785SH4425893	1F66F5DY4H0A06663
785SH4425899	1F66F5DY5H0A04484
785AH4425904	1F66F5DY8H0A09968
785AH4425916	1F66F5DY7H0A09766
785SH4425984	1F66F5DY5H0A09166

REV Unit Serial #	Chassis/VIN
785SH4425987	1F66F5DY3H0A09165
785SH4425993	1F66F5DY3H0A09490
785SH4426095	1F66F5DY9H0A10983
785AH4426112	1F66F5DY9H0A10370
785AH4426116	1F66F5DY2H0A10968
785AH4426122	1F66F5DY1H0A09486
785SH4426244	1F66F5DY4H0A09157
785AH4426251	1F66F5DY8H0A11896
785SH4426255	1F66F5DY0H0A11598
785SH4426261	1F66F5DY8H0A08352
785AH4426288	1F66F5DY5H0A09488
785SH4426299	1F66F5DYXH0A09177
785SH4426303	1F66F5DY2H0A09156
785AH4426314	1F66F5DYXH0A09762
785AH4426361	1F66F5DY9H0A11891
785AH4426366	1F66F5DY7H0A10965
785AH4426370	1F66F5DY0H0A10967
785SH4426381	1F66F5DY7H0A11596
785SH4426447	1F66F5DY8H0A09162
785AH4426461	1F66F5DY2H0A10372
785AH4426471	1F66F5DY2H0A10971
785SH4426507	1F66F5DY6H0A12299
785SH4426517	1F66F5DY2H0A12607
785AH4426523	1F66F5DY0H0A10371
785AH4426528	1F66F5DY4H0A11894
785AH4426532	1F66F5DY9H0A10966
785AH4426583	1F66F5DY6H0A10973
785AH4426589	1F66F5DY4H0A10969
785SH4426656	1F66F5DY4H0A12298
785SH4426666	1F66F5DY0H0A13173
785SH4426678	1F66F5DY4H0A12303
785SH4426681	1F66F5DY6H0A12285

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Product Upgrade Bulletin 170615REV - Affected Unit Serial Numbers

2017 Holiday Rambler Vacationer XE, Models 32A and 34S

REV Unit Serial #	Chassis/VIN
685AH4423395	1F66F5DY1G0A10913
685AH4423903	1F66F5DY3G0A14767
685AH4423964	1F66F5DY4G0A15524
685SH4423976	1F66F5DY9H0A00115
685AH4424014	1F66F5DY2G0A15523
685AH4424072	1F66F5DY7G0A15534
685AH4424082	1F66F5DY5G0A15533
685AH4424095	1F66F5DY3G0A15529
685AH4424101	1F66F5DYXG0A15530
685AH4424123	1F66F5DY6G0A15525
685AH4424129	1F66F5DY7H0A01344
685AH4424198	1F66F5DY1G0A14766
685AH4424202	1F66F5DY9H0A00096
685AH4424207	1F66F5DY2H0A00859
685AH4424293	1F66F5DY3H0A01342
685AH4424301	1F66F5DYXH0A01340
685AH4424424	1F66F5DY8H0A00865
685SH4424441	1F66F5DY8H0A01370
685AH4424486	1F66F5DY0H0A00455
685SH4424488	1F66F5DY6H0A01366
685SH4424498	1F66F5DY7H0A00114
685AH4424501	1F66F5DY0H0A00861
685SH4424552	1F66F5DYXH0A02164
685SH4424622	1F66F5DY4H0A01365
685AH4424644	1F66F5DY5H0A00094
685SH4424696	1F66F5DY1H0A00870
685SH4424702	1F66F5DYXH0A01371
685AH4424769	1F66F5DY4H0A00457
685SH4424812	1F66F5DY4H0A03987
685SH4424814	1F66F5DY1H0A03140
685AH4424820	1F66F5DY3H0A01695
685SH4424824	1F66F5DY1H0A03638
685SH4424828	1F66F5DY4H0A03990
685AH4424832	1F66F5DY2G0A14761

REV Unit Serial #	Chassis/VIN
685AH4424834	1F66F5DY4H0A00460
685SH4424888	1F66F5DY3H0A03141
685AH4424912	1F66F5DY5H0A01343
685SH4425004	1F66F5DY5H0A02167
685SH4425028	1F66F5DY8H0A04480
685SH4425158	1F66F5DY7H0A04485
685AH4425162	1F66F5DY3H0A03978
685SH4425208	1F66F5DY5H0A05117
685AH4425261	1F66F5DY4H0A05576
685AH4425429	1F66F5DY4H0A07649
685AH4425489	1F66F5DY5H0A07983
685SH4425551	1F66F5DY8H0A07038
685SH4425560	1F66F5DY6H0A07037
685AH4425594	1F66F5DYXH0A08790
685SH4425667	1F66F5DY2H0A06662
685AH4425717	1F66F5DY3H0A09134
685AH4425719	1F66F5DY1H0A09133
685AH4425721	1F66F5DY1H0A08791
685AH4425723	1F66F5DY3H0A08789
685SH4425773	1F66F5DYXH0A07039
685AH4425777	1F66F5DY5H0A09135
685SH4425833	1F66F5DY0H0A06661
685SH4425838	1F66F5DY4H0A07036
685SH4425847	1F66F5DY0H0A07034
685AH4425892	1F66F5DY6H0A09757
685AH4425897	1F66F5DY9H0A09767
685AH4425898	1F66F5DYXH0A09972
685AH4425906	1F66F5DY6H0A09970
685AH4425909	1F66F5DY8H0A09971
685AH4425911	1F66F5DY5H0A09975
685SH4425915	1F66F5DY2H0A09142
685AH4425918	1F66F5DY9H0A09753
685AH4426057	1F66F5DY3H0A09487
685SH4426063	1F66F5DY0H0A09155

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Product Upgrade Bulletin 170615REV - Affected Unit Serial Numbers

2017 Holiday Rambler Vacationer XE, Models 32A and 34S

REV Unit Serial #	Chassis/VIN
685AH4426069	1F66F5DY0H0A09141
685AH4426074	1F66F5DY1H0A09973
685SH4426101	1F66F5DY6H0A08821
685SH4426108	1F66F5DY8H0A10988
685AH4426119	1F66F5DY8H0A09484
685SH4426120	1F66F5DY6H0A10987
685AH4426374	1F66F5DY8H0A09758
685SH4426385	1F66F5DY9H0A08179
685SH4426464	1F66F5DY0H0A11603
685AH4426468	1F66F5DY5H0A10964
685AH4426596	1F66F5DY8H0A10974
685AH4426607	1F66F5DY4H0A12284

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."