



SERVICE BULLETIN

Classification: FA17-005	Reference: NTB17-042	Date: April 17, 2017
-----------------------------	-------------------------	-------------------------

VERSA SEDAN, VERSA NOTE, AND MICRA SQUEAK IN FRONT SUSPENSION WHEN DRIVING OVER BUMPS

APPLIED VEHICLES: 2012 – 2016 Versa Sedan (N17)
2014 – 2016 Versa Note (E12)
2015 – 2016 Micra (K13)

IF YOU CONFIRM

Squeak noise coming from the stabilizer bushings (see Figure 1) while driving over bumps at slow speeds,

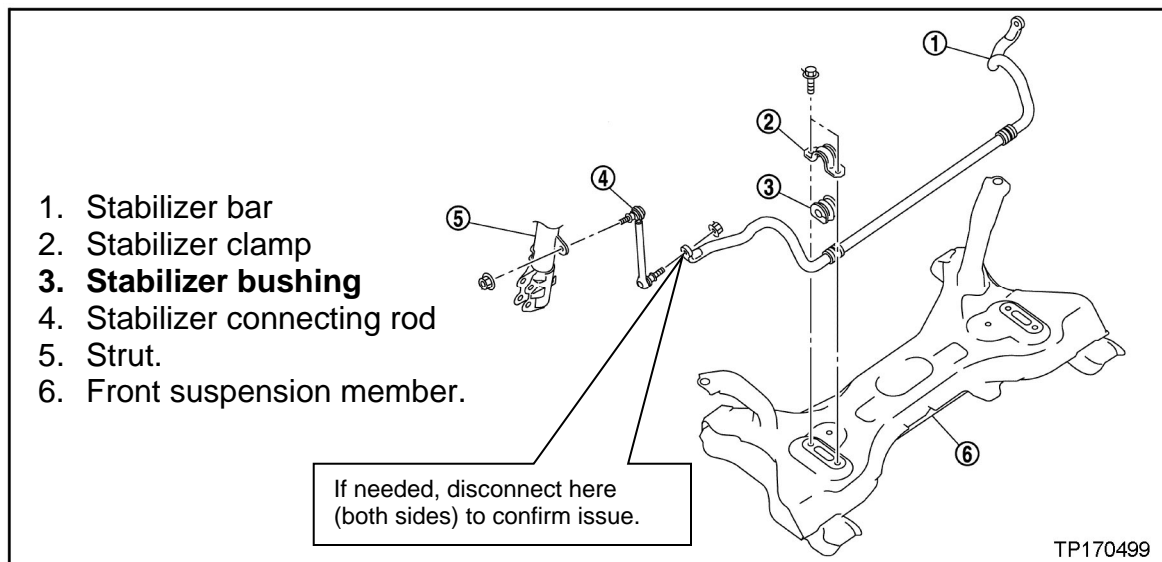


Figure 1

NOTE: To confirm the squeak is coming from the stabilizer bushing, it may be necessary to:

- Disconnect the stabilizer connecting rod from the stabilizer bar – both sides (see Figure 1).
- Drive the vehicle slowly over bumps to confirm the squeak is eliminated.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

ACTION

Replace **both** stabilizer bushings.

- Refer to the Electronic Service Manual (ESM), section FSU-Front Suspension, for stabilizer bushing replacement.
- Stabilizer bushings are listed in the Parts Information.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Stabilizer Bushing	54613 - 3WC0B	2

CLAIMS INFORMATION

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Stabilizer Bushings	(1)	MA54AA	ZL	32	(2)

(1) Reference the Parts Information Table and use the Stabilizer Bushing as the PFP.

(2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.

