

Technical Information Service 13/17 ENU AH01

AH01 - Replacing Fastening Screws For Fuel Collection Pipes (Stop-Sale Campaign)

Revision: February 23, 2017

This revision amends AHO1 as follows:

1 — The work procedure was amended to include removing the rear-axle cross member completely to gain additional space when lowering the engine.

2 — Scope 12 was added for cars where a replacement engine was installed but not documented. With this scope, the engine number must be checked according to a list published via PPN to determine if the newly installed engine is affected or not.

Model Year: 2017

Vehicle Type: 718 Boxster (982)/718 Boxster S (982)

Subject: Fastening screws for fuel collection pipes

Concern: There is a possibility that the fastening screws for the fuel collection pipes on the affected vehicles can shear off due to stress corrosion cracking.

If this happens, the high fuel pressure that builds up in the fuel injection system when the engine is running can press the relevant fuel collection pipe off the fuel injectors. This can cause a fuel leak in the engine compartment.

Remedial Action:

Replace fastening screws for both fuel collection pipes.



Information

Vehicles with replacement engine installed

On vehicles in which a **replacement engine was installed** and the relevant **engine number was not documented**, we **cannot be sure** that the correct fastening screws were used. These vehicles are **also assigned to Scope 12**.

The engine number on the vehicles must first be checked. The fastening screws may or may not have to be **replaced**, **depending on the result of the check**.

For instructions and further information, see \Rightarrow *Technical Information 'AH0100 Scope 12 - Checking engine number'*.


To find out which campaign scope is assigned to the respective vehicle for this campaign, see PIWIS Vehicle Information.

Parts Info: NOTE: NECESSARY PARTS FOR THIS CAMPAIGN ARE STILL BEING MANUFACTURED AND ARE

EXPECTED TO ARRIVE CWO7. ONCE THE REQUIRED PARTS FOR THIS CAMPAIGN HAVE ARRIVED, PCNA

WILL BEGIN THE AUTOMATIC ALLOCATION PROCESS FOR UP TO 50% OF THE VEHICLES THAT ARE SERVICED AT YOUR DEALERSHIP. APPROXIMATELY 45 DAYS AFTER YOUR FIRST ALLOCATION, YOUR DEALER WILL AUTOMATICALLY BE ALLOCATED AN ADDITIONAL 30% OF THE REQUIRED PARTS FOR THE VEHICLES THAT ARE STILL IN NEED OF REPAIR.

Installation position:

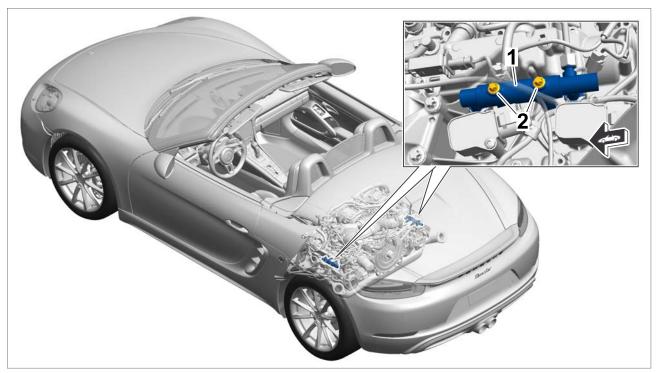

Overview of installation position (shown on 718 Boxster as an example)

- 1 Fuel collection pipe
- 2 Fastening screws (replace)

Affected Only the vehicles assigned to the campaign (see also PIWIS Vehicle information). This campaign affects

Vehicles: 4,518 vehicles in North America.

Parts required

Part No.:	Part No.	Designation - Use	Qty.
	000 043 306 00	⇒ Torx screw, BM 6 x 85	4 ea.

13/17 ENU AHO1	Technical Information	Service			$\overline{}$
		 13/17	ENU	AHO1	

999 076 053 01	⇒ Hexagon nut, M10– Rear diagonal brace	12 ea.
999 072 840 01	⇒ Hexagon-head bolt, M10 x 35− Diagonal brace to body	2 ea.
N 908 484 05	⇒ Hexagon nut, M12 x 1.5– Engine carrier to engine mount	2 ea.

Required tools

Tools:

- Torque screwdriver, 1.5 3 Nm (1 2 ftlb.), e.g. VAS 6494 Torque screwdriver
- Torque wrench, 6 50 Nm (4.5 37 ftlb.), e.g. V.A.G 1331 Torque wrench, 6-50 Nm (4.5-37 ftlb.)
- Torque wrench, 40 200 Nm (30 148 ftlb.), e.g. V.A.G 1332 Torque wrench, 40-200 Nm (30-148 ftlb.)
- Torque/torque angle screw tool, 20 400 Nm (15 296 ftlb.), e.g. VAS 6942 Torque/torque angle screw tool
- Hydraulic transmission jack, e.g. VAS 6931 Engine and gearbox jack
- VAS 6918 Quick-Clamping Unit
- 9229/1 Puller hook
- Battery Charger/Power Supply Suitable for AGM Type batteries, recommended current rating of 70A fixed voltage 13.5V to 14.5V.
- 9900 PIWIS Tester 3
- Plastic assembly wedge (commercially available)

If the **wheel alignment values** must be **corrected** during suspension alignment, the following tools will also be required:

- 9626 Insert for torque wrench
- 9730 Socket-wrench insert
- 9847 Socket-wrench insert
- VAS 6430/1A Setting Device with Reflector
- VAS 6430/3 ACC reflector mirror
- VAS 6190/2 T-bar Setting Tool for ACC Sensor

Preparatory work


Work Procedure: 1 Raise the vehicle on a lifting platform ⇒ Workshop Manual '4X00IN Lifting the vehicle'.

- 2 Move convertible top to service position ⇒ Workshop Manual '6101IN Convertible-top service position'.
- 3 Relieve fuel pressure in the system.
 - 3.1 Remove cover on the fuse carrier in the passenger compartment at the front left.

3.2 Pull out fuse for fuel pump.

The fuse (20 A) is in **row B** ⇒ Fuse carrier in passenger compartment at the front left

-1-, slot **FB5** ⇒ Fuse carrier in passenger compartment at the front left -2-.

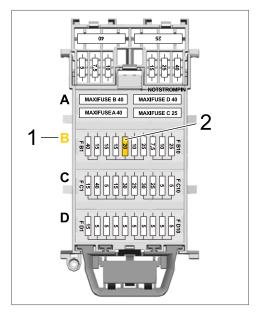

Fuse carrier in passenger compartment at the front left



Exhaust gases

- · Risk of Carbon Monoxide (CO) Poisoning
- ⇒ Before starting the engine, position an exhaust extraction system behind the vehicle's exhaust pipes and switch it on.
 - 3.3 Start the engine and leave it running at idle speed until it cuts out. **This can take up to 5 minutes.**
 - 3.4 Switch off ignition and remove ignition key.
 - 3.5 Re-insert fuse for fuel pump.
 - 4 Disconnect ground line at the battery ⇒ Workshop Manual '2X00IN Work instructions after disconnecting the battery'.
 - Remove trim panel for convertible top compartment ⇒ Workshop Manual '700819 Removing and installing trim panel for convertible top compartment/engine compartment lid'.
 - 6 Remove engine compartment lid *⇒ Workshop Manual '557819 Removing and installing engine compartment lid'*.
 - Remove air cleaner housing ⇒ Workshop Manual '242519 Removing and installing air cleaner housing'.

13/17 ENU AH01

- 8 Remove rear wheels ⇒ Workshop Manual '440519 Removing and reinstalling wheel'.
- 9 Remove cover for rear underbody ⇒ Workshop Manual '519419 Removing and installing cover for rear underbody'.
- 10 Remove diagonal braces on the rear axle ⇒ Workshop Manual '421320 Removing and installing struts'.
- 11 Remove support plate on the rear axle ⇒ Workshop Manual '421419 Removing and installing support plate'.
- 12 Remove rear-axle cross member ⇒ Workshop Manual '420619 Removing and installing rear-axle cross member'.

Replacing fastening screws for fuel collection pipes

 
Work Procedure: 1 Lowering the engine to complete other work.


1.1 Loosen fastening nuts ⇒ Turning tailpipe cover-2- on both clamps ⇒ Turning tailpipe cover-1- for the tailpipe cover and turn the tailpipe cover as far as required until the tailpipes are pointing downwards.



Information

- The weight must be distributed uniformly on the oil pan.
- Never apply localised pressure to the oil pan.



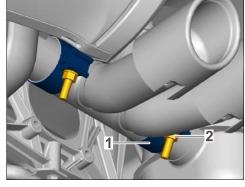

Turning tailpipe cover



Information

- When lowering the engine, it must not rest on the rear-axle cross member.
- The exhaust system must not touch against the body or rear apron when lowering it.
- Always be careful of hoses, lines and cables when lowering the system!
- Always avoid collisions!
- 1.3 Lower the engine as far as required until the fastening screws for the fuel collection pipes are accessible.

For instructions, see \Rightarrow Workshop Manual '1001IN Lowering the engine to complete other work'.

- 2 Replace fastening screws for fuel collection pipes.
 - 2.1 Loosen and unscrew front fastening screw

 
 ⇒ Replacing fastening screws -2- (viewed in direction of travel) for fuel collection pipe on cylinder 1–3 ⇒ Replacing fastening screws


 -1-.
 - 2.2 Screw in and tighten new fastening screw, Part No. 000 043 306 00.

Tightening torque 13 Nm (9.5 ftlb.)

- 2.3 Loosen and unscrew rear fastening screw

 ⇒ Replacing fastening screws -3- for fuel
 collection pipe on cylinder 1–3 ⇒ Replacing
 fastening screws -1-.
- 2.4 Screw in and tighten new fastening screw, Part No. 000 043 306 00.



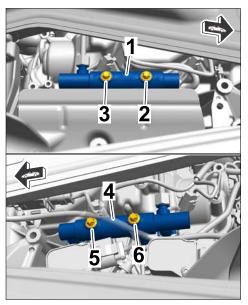

Replacing fastening screws

- 2.5 Repeat steps **3.1 to 3.4** on the fuel collection pipe on cylinder 4–6 ⇒ *Replacing fastening screws* **-4** in order to replace the fastening screws ⇒ *Replacing fastening screws* **-5 and 6**-.
- Raise the engine to installation position and secure it.
 For instructions, see ⇒ Workshop Manual '1001IN Lowering the engine to complete other work'.
- 4 Turn tailpipe cover into installation position and align it with respect to the rear apron. Then secure the tailpipe cover.
 For instructions, see ⇒ Workshop Manual '263519 Removing and installing tailpipe cover'.

Concluding work

Wok Procedure: 1 Install rear-axle cross member ⇒ Workshop Manual '420619 Removing and installing rear-axle cross member'.

- Install support plate on the rear axle \Rightarrow Workshop Manual '421419 Removing and installing support plate'.
- 3 Install diagonal braces on the rear axle ⇒ Workshop Manual '421320 Removing and installing struts'.
- 4 Install cover for rear underbody ⇒ Workshop Manual '519419 Removing and installing cover for rear underbody'.
- 5 Install rear wheels ⇒ Workshop Manual '440519 Removing and reinstalling wheel'.

13/17 ENU AHO1

 
- 6 Install air cleaner housing ⇒ Workshop Manual '242519 Removing and installing air cleaner housing'.
- 7 Install engine compartment lid ⇒ Workshop Manual '557819 Removing and installing engine compartment lid'.
- 8 Install trim panel for convertible top compartment ⇒ Workshop Manual '700819 Removing and installing trim panel for convertible top compartment/engine compartment lid'.
- 9 Connect ground line for battery ⇒ Workshop Manual '2X00IN Work instructions after disconnecting the battery'.
- 10 Bleed the high-pressure side of the fuel system.
 - suitable for AGM type batteries, recommended current rating of 70A fixed voltage 13.5V to 14.5V.

 First connect the positive cable of the charger to the positive terminal of the battery and then connect the negative cable of the charger to the ground point for jump-lead starting


 \$\Rightarrow External power connection.\$

Connect a battery charger or power supply,

- Then switch on the battery charger and start charging the battery.
- 10.2 Switch on the ignition.
- 10.3 Connect the PIWIS Tester to the vehicle communication module (VCI) via the USB cable. Then connect the communication module to the vehicle and switch on the PIWIS Tester.
- 10.4 On the PIWIS Tester start screen, call up the 'Diagnostics' menu.



- 10.5 Bleed the high-pressure side of the fuel system using the PIWIS Tester ⇒ Workshop Manual '200107 Bleeding fuel system on high-pressure side First start function'.
- 10.6 Read out and erase the fault memory ⇒ Workshop Manual '033500 Fault memory for on-board diagnosis'.

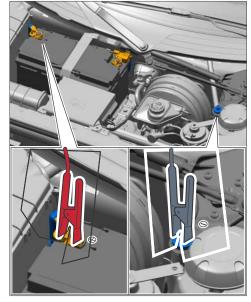

External power connection



Information

If control units are found to have faults that are **not** related to this workshop campaign, these must be found and corrected separately. This work cannot be invoiced under the workshop campaign number.

- 10.7 Switch off the ignition.
- Disconnect the PIWIS Tester from the vehicle. 10.8
- 10.9 Switch off and disconnect the battery charger.
- 11 Move convertible top out of service position ⇒ Workshop Manual '6101IN Convertible-top service position'.
- 12 Remove the vehicle from the lifting platform.
- 13 Perform suspension alignment and make adjustments.
 - ⇒ Workshop Manual '449503 Suspension alignment, complete'
 - ⇒ Workshop Manual '4495TW Adjustment values for suspension alignment'
- 14 After correcting the wheel alignment values, carry out the following required subsequent work.
 - 14.1 Calibrate steering-angle sensor ⇒ Workshop Manual '456005 Initialising and calibrating PSM steering-angle sensor'.
 - 14.2 Teach steering lock settings for the power-steering gear ⇒ Workshop Manual '489025 Power-steering gear: Teaching steering lock settings'.
 - If installed: Calibrate control unit for distance measuring sensor (ACC) ⇒ Workshop Manual '278515 Adjusting control unit for distance measuring sensor'.
 - 14.4 **If installed**: Calibrate front camera. For instructions, see ⇒ Workshop Manual '963855 Replacing front camera'.
- 15 Enter the campaign in the Warranty and Maintenance booklet.

References:

- ⇒ Workshop Manual '033500 Fault memory for on-board diagnosis'
- ⇒ Workshop Manual '1001IN Lowering the engine to complete other work'
- ⇒ Workshop Manual '2X00IN Work instructions after disconnecting the battery'
- ⇒ Workshop Manual '200107 Bleeding fuel system on high-pressure side · First start function'
- ⇒ Workshop Manual '242519 Removing and installing air cleaner housing'
- ⇒ Workshop Manual '263519 Removing and installing tailpipe cover'
- ⇒ Workshop Manual '278515 Adjusting control unit for distance measuring sensor'
- ⇒ Workshop Manual '4X00IN Lifting the vehicle'
- ⇒ Workshop Manual '420619 Removing and installing rear-axle cross member'
- ⇒ Workshop Manual '421320 Removing and installing struts'
- ⇒ Workshop Manual '421419 Removing and installing support plate'
- ⇒ Workshop Manual '440519 Removing and installing wheel'

Service

13/17 ENU AH01

2

- ⇒ Workshop Manual '4495TW Adjustment values for suspension alignment'
- ⇒ Workshop Manual '449503 Suspension alignment, complete'
- ⇒ Workshop Manual '456005 Initialising and calibrating PSM steering-angle sensor'
- ⇒ Workshop Manual '489025 Power-steering gear: Teaching steering lock settings'
- ⇒ Workshop Manual '519419 Removing and installing cover for rear underbody'
- ⇒ Workshop Manual '557819 Removing and installing engine compartment lid'
- ⇒ Workshop Manual '6101IN Convertible-top service position'
- ⇒ Workshop Manual '700819 Removing and installing trim panel for convertible top compartment/engine compartment lid'
- ⇒ Workshop Manual '963855 Replacing front camera'

Warranty processing

Information: Scope 1 – Scope 6: Not relevant for this vehicle type.



Information

The working times specified below were determined specifically for carrying out this campaign and may differ from the working times published in the Labor Operation List in PIWIS.

Scope 7: Replacing fastening screws for fuel collection pipes

Vehicle equipment:

- without adaptive cruise control ACC
- without front camera

Working time:

Replacing fastening screws for fuel collection pipes

Includes: Raising and lowering the vehicle

Moving convertible top into service position

Reducing fuel pressure

Disconnecting and connecting battery

Removing and installing trim panel for convertible top

compartment

Removing and installing engine compartment lid Removing and installing air cleaner housing

Removing and installing rear wheels

Removing and installing cover for rear underbody

Removing and installing diagonal braces
Removing and installing support plate

Removing and installing rear-axle cross member

Loosening and securing tailpipe cover

Loosening and securing engine

Connecting and disconnecting battery charger Connecting and disconnecting PIWIS Tester Labor time: 511 TU

Technical Information

Labor time: 561 TU

Bleeding fuel high-pressure system

Reading out and erasing fault memory

Performing suspension alignment and adjusting the vehicle

Calibrating steering-angle sensor Teaching steering lock settings

Without: Calibrating control unit for distance measuring sensor

Calibrating front camera

Parts required:

000 043 306 00 Torx screw, BM 6 x 85 4 ea.

- Fuel collection pipe

999 076 053 01 Hexagon nut, M10 12 ea.

- Rear diagonal brace

999 072 840 01 2 ea. Hexagon-head bolt, M10 x 35

Diagonal brace to body

N 908 484 05 2 ea. Hexagon nut, M12 x 1.5

- Engine carrier to engine mount

⇒ Damage Code AH01 099 000 2

Scope 8: Replacing fastening screws for fuel collection pipes

Vehicle equipment:

Adaptive cruise control ACC (I-no. 456) and/or front camera (I-no. 631, 632 or 852)

Working time:

Replacing fastening screws for fuel collection pipes

Includes: Raising and lowering the vehicle

Moving convertible top into service position

Reducing fuel pressure

Disconnecting and connecting battery

Removing and installing trim panel for convertible top

compartment

Removing and installing engine compartment lid Removing and installing air cleaner housing

Removing and installing rear wheels

Removing and installing cover for rear underbody

Removing and installing diagonal braces Removing and installing support plate

Removing and installing rear-axle cross member

Loosening and securing tailpipe cover Loosening and securing engine

Connecting and disconnecting battery charger

Service

13/17 ENU AH01

2

Connecting and disconnecting PIWIS Tester

Bleeding fuel high-pressure system

Reading out and erasing fault memory

Performing suspension alignment and adjusting the vehicle

Calibrating steering-angle sensor Teaching steering lock settings

Calibrating control unit for distance measuring sensor

Calibrating front camera

Parts required:

000 043 306 00	Torx screw, BM 6 x 85	4 ea

- Fuel collection pipe

999 076 053 01 Hexagon nut, M10 12 ea.

- Rear diagonal brace

999 072 840 01 Hexagon-head bolt, M10 x 35 2 ea.

- Diagonal brace to body

N 908 484 05 Hexagon nut, M12 x 1.5 2 ea.

- Engine carrier to engine mount

⇒ Damage Code AH01 099 000 2

Scope 12 - Checking engine number



Information

Vehicles with replacement engine installed

On vehicles in which a **replacement engine was installed** and the relevant **engine number was not documented**, we **cannot be sure** that the correct fastening screws were used. The engine number on these vehicles must first be checked.

A corresponding **list of the replacement engines affected by the campaign** is available for this purpose in the PPN portal.

If a **replacement engine affected** by this campaign was **installed** in the respective vehicle, the **campaign** must be **carried out** in accordance with the scope that is also assigned to the vehicle. If the respective **replacement engine is not affected**, **no further action** is required.

Work Procedure: 1 Raise the vehicle on a lifting platform ⇒ Workshop Manual '4X00IN Lifting the vehicle'.

- 2 Remove cover for rear underbody ⇒ Workshop Manual '519419 Removing and installing cover for rear underbody'.
- 3 Check the engine number using the list provided in the PPN portal.

Technical Information

Labor time: 47 TU

- The **engine number** of the installed engine **is included in the list of engines**: The **fastening screws** for the fuel collection pipes must be **replaced**. Continue with ⇒ *Technical Information 'AH0100 AH01 Recall campaign Replacing fastening screws for fuel collection pipes'*.
- The **engine number** that was read off is **not** included in the list: The installed engine is **not affected**. Complete the vehicle and remove it from the lifting platform. **End of action required**. For invoicing, see Scope 12.

Scope: Scope 12 – Checking engine number



Information

Scope 12 must only be invoiced if the installed replacement engine is **not** affected by this campaign and **no fastening screws must be replaced**.

Working time:

Checking engine number of the installed replacement engine

Includes: Raising and lowering the vehicle

Removing and installing cover for rear underbody

⇒ Damage Code AH01 099 000 1

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. If a particular condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Porsche Dealer for the latest information about whether a particular technical bulletin applies to your vehicle. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify the current and correct part numbers. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS

Tester are the ones that must be followed.

Dealership	Service Manager	 Shop Foreman	 Service Technician	 	
Distribution					
Routing	Asst. Manager	 Warranty Admin.	 Service Technician	 	

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macana®, Panamera®, Speedster®, Spyder®, Tiptronic®, VarioCam®, PCM®, PDK®, 911®, RS®, 4S®, 718®, 918 Spyder®, FOUR UNCOMPROMISED®, and the model numbers and distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. However, specifications, standard equipment and options are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. Please ask your authorized Porsche dealer for advice concerning the current availability of options and verify the optional equipment that you ordered. Porsche recommends seat belt usage and observance of traffic laws at all times.