

Limited Validity - Warning Message "Spoiler fault": Replacing spoiler (60/17)



Information

This Quick Information shall remain valid until September 2017 and will be replaced as soon as further information becomes available.

Until such a time as further information becomes available, the procedure described below must be followed.

Vehicle Type: **Panamera Turbo (971)**

Model Year: **2017**

Equipment: Turbo (I-no. A8H)

Subject: **Rear spoiler**

Information: **The clamping nut on the connecting link on the rear spoiler can become loose:**

- As a result, the **side spoiler flap can no longer be retracted,**
- a **warning message "Spoiler failure"**, "Spoiler fault" or "Spoiler control fault" appears in the instrument cluster and
- the **fault codes "EA6407" and "F00101"** are entered in the rear-end electronics control unit.


**Information**

In the event of a **customer complaint and if fault codes are entered**, the type of rear spoiler installed must be checked:

The new type differs from the previous type in that it has a clamping screw (see ⇒ *Spoiler with clamping screw*-**item A**-).

⇒ If there is **still a clamping nut** on the connecting link on the existing rear spoiler, **the rear spoiler must be replaced**.

⇒ **The faulty clamping sleeve/a loose clamping nut must not be replaced or repaired.**

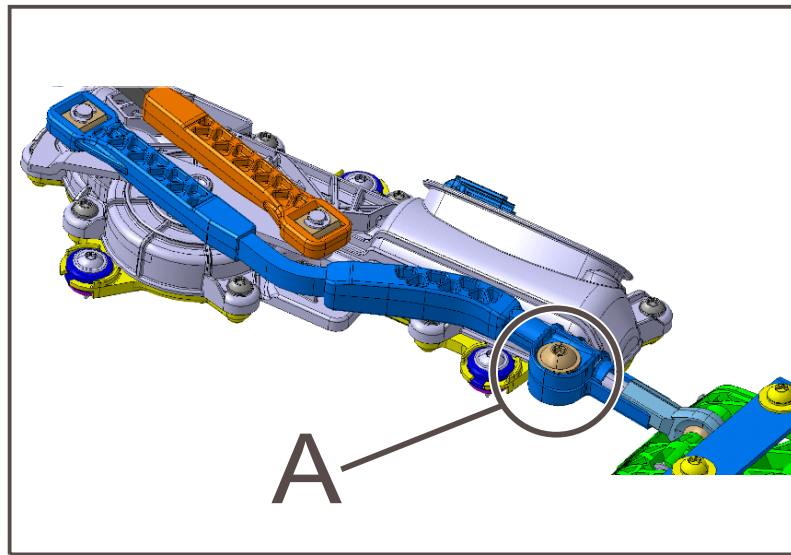

Spoiler with clamping screw

Date of Introduction: Modified rear spoilers have been installed during production since December 2016.

Parts Info: 971.827.678.AYG.2X ⇒ Rear spoiler

Invoicing: The work involved is invoiced under the labor operation:

APOS	Labor operation	I No.
66586151	Painting new rear spoiler	
66581900	Removing and installing rear spoiler	

For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	66580	Rear spoiler
Damage type (SA4)	1612	Does not function in some cases

References: ⇒ *Workshop Manual '66581900 Removing and installing rear spoiler'*

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. If a particular condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Porsche Dealer for the latest information about whether a particular technical bulletin applies to your vehicle. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify the current and correct part numbers. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© Porsche Cars North America, Inc.

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macan®, Panamera®, Speedster®, Spyder®, Tiptronic®, VarioCam®, PCM®, PDK®, 911®, RS®, 4S®, 718®, 918 Spyder®, FOUR UNCOMPROMISED®, and the model numbers and distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. However, specifications, standard equipment and options are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. Please ask your authorized Porsche dealer for advice concerning the current availability of options and verify the optional equipment that you ordered. Porsche recommends seat belt usage and observance of traffic laws at all times.

Printed in the USA